



02054391

Andrews, David

103-11282

**From:** matthew.j.amos@exxonmobil.com on behalf of pcu.hp321@exxonmobil.com  
**Sent:** Monday, December 07, 2009 1:27 PM  
**To:** jay\_johnson@blm.gov; Andrews, David  
**Cc:** joe.davis@exxonmobil.com; kendall.holmes@exxonmobil.com  
**Subject:** Surface casing pressure test FRU 297-16A8

**Follow Up Flag:** Follow up  
**Flag Status:** Flagged

Gents,

We tested our 10 3/4" surface casing this morning and the pressure tests failed. We will be running a Halliburton RTTS packer to isolate the casing leak. We assume that the leak is at the DV-Tool (1,020'). Once casing leak is isolated, we will be running a Weatherford casing patch. Please contact the rig at 970--756-2061 with any questions or concerns.

Regards,

Matt Amos

Drilling Supervisor: H&P 321