

DOS RIOS J 33-10
API 05-123-15234
NWSE SEC 23 T5N-R66W
WELD COUNTY, CO

Plug and Abandon Planned Procedures

- 1 Install anchors on location if required.
- 2 Call Foreman or Lead Pumper before rig up to isolate production equipment. Confirm if replacement parts/equipment are required. Notify Foreman at least 24 hours prior to moving in the service rig.
- 3 MIRU WO rig. Kill well, as necessary, with 2% KCL water with biocide. ND wellhead. NU BOP's. Unseat landing joint and lay down.
- 4 Move and rig up wireline truck. Pick up 5K CIBP and run in hole. Set CIBP at 4730 feet and dump 2 sx of cement on top of CIBP. Pull out of hole with wireline and rig down wireline truck.
- 5 Nipple down BOPS and tubing head. Un-land 4-1/2" casing from slips and work casing. Free-point casing and cut accordingly. Estimated top of cement is at 3942 feet.
- 6 Trip out of the hole with 4.5' casing and laying it down.
- 7 Trip in the hole with tubing and sting into the casing 50 feet. Set 100 feet balance cement plug across the casing stub (1/2 in and 1/2 out).
- 8 Pull out of hole with tubing string to 375'. Pump cement from 375' to surface and trip out of hole with tubing. Top off the cement inside the 8-5/8" to just below the casing head.
- 9 Rig down move of workover rig.
- 10 Cut surface casing 5 feet below ground level and weld on cap.
- 11 Submit Subsequent Report of Abandonment Form 6 with COGCC.