

Koch Exploration Company, LLC  
Plug and Abandonment Procedure  
WRD Federal 35-1

Well Information:

API No: 05-103-09381  
Location: SWNE Sec. 35-T2N-R97W  
Elevation: GL @ 5846'  
TD: 1296'  
Surf Csg: 7" 23# R-3 LS Rd @ 247'  
Prod Csg: 2 7/8" 6.4# Tubing @ 1296' cemented in 6 1/4" Open Hole w/ 206 sacks cement  
TOC: 1080'  
Perforations: 1088-1100'

Procedure:

1. MIRU service rig. Bleed off pressure. Remove wellhead and install BOP.
2. RIH with free-point through 2 7/8" tubing. POOH.
3. Cut 2 7/8" tubing at 1038' and POOH.
4. RIH with 2 3/8" work string and set first plug with 115 sacks cement (1.16 ft<sup>3</sup>/sk). After an appropriate waiting period, top will be tagged before next plug set.
5. RIH with 2 3/8" work string and set second plug with 115 sacks cement (1.16 ft<sup>3</sup>/sk). After an appropriate waiting period, top will be tagged before next plug set.
6. Spot 47 sacks cement (1.16 ft<sup>3</sup>/sk) from second plug top to surface.
7. Cut off wellhead at least 3' below final restored ground level and install dry hole marker as per Onshore Order #2.
8. Reclaim location as per BLM regulations.