

FORM  
6Rev  
12/05State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400372237

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Travis Yenne

Name of Operator: PDC ENERGY INC

Phone: (970) 506-9272

Address: 1775 SHERMAN STREET - STE 3000

Fax: (970) 506-9276

City: DENVER State: CO Zip: 80203

Email: Travis.Yenne@pdce.com

For "Intent" 24 hour notice required,

Name: MONTOYA, JOHN

Tel: (970) 3974124

COGCC contact:

Email: john.montoya@state.co.us

API Number 05-123-12237-00

Well Name: DIC CROSS

Well Number: 31-32

Location: QtrQtr: NWNE Section: 32 Township: 5N Range: 64W Meridian: 6

County: WELD

Federal, Indian or State Lease Number: 68832

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.361111

Longitude: -104.571111

GPS Data:

Date of Measurement: 04/16/2010

PDOP Reading: 1.3

GPS Instrument Operator's Name: Chuck Kraft

Reason for Abandonment: ☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 5596

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☒ Yes☐ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Code	Perf. Top	Perf. Bottom	Date	Method of Isolation	Plug Depth
CODELL	CODL	6899	6910			
NIOBRARA	NBRR	6644	6812			

Total: 2 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	306	250	306	0	CALC
1ST	7+7/8	4+1/2	11.6	7,003	200	7,003	5,696	

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6490 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 60 sks cmt from 5496 ft. to 5596 ft. Plug Type: STUB PLUG Plug Tagged: ☒

Set 300 sks cmt from 3605 ft. to 4275 ft. Plug Type: OPEN HOLE Plug Tagged: ☐

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 300 sacks half in. half out surface casing from 1000 ft. to 0 ft. Plug Tagged: ☐

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure  
Niobrara-Codell  
Existing Perforations:  
Niobrara: 6644'-6812'  
Codell: 6899'-6910'  
PBSD: 6952'  
8 5/8" 24# Casing set @ 306' cemented w/ 250 sx  
4 1/2" 11.6# Casing set @ 7003' cemented w/ 250sx  
Procedure:  
1)MIRU Wireline  
2)RIH w/CIBP @ 6490'  
3)RIH w/dump bailer, Spot 2 sx cement over CIBP  
4)RIH w/CBL, locate TOC  
5)TIH w/casing cutter, cut and pull casing  
6)TIH and set 50' plug @ stub (5596')  
7)TOH and set 300' plug @ Parkman  
8)TOH and set cement plug 1000' to surface  
9)Set 10 sx @ top of surface  
10)Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Travis Yenne

Title: Engineer Date: \_\_\_\_\_ Email: Travis.Yenne@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**Attachment Check List**

Att Doc Num	Name
400372256	WELLBORE DIAGRAM
400372257	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)