

FORM  
6Rev  
12/05State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400376835

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: CHERYL LIGHT

Name of Operator: KERR-MCGEE OIL &amp; GAS ONSHORE LP

Phone: (720) 929-6461

Address: P O BOX 173779

Fax: (720) 929-7461

City: DENVER State: CO Zip: 80217-

Email: CHERYL.LIGHT@ANADARKO.COM

For "Intent" 24 hour notice required,

Name: HICKEY, MIKE

Tel: (970) 302-1024

COGCC contact:

Email: mike.hickey@state.co.us

API Number 05-123-09468-00

Well Name: UPRR 42 PAN AM AS

Well Number: 1

Location: QtrQtr: NWSW Section: 7 Township: 1N Range: 67W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.062000

Longitude: -104.938070

GPS Data:

Date of Measurement: 07/07/2006

PDOP Reading: 2.0

GPS Instrument Operator's Name: Chris Fisher

Reason for Abandonment: ☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 211

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details: Well has 2 cement squeezes completed 11/03/1994 - 100 sx of class "G" @ 260' and 83 sx of class "G" @ 735'

## Current and Previously Abandoned Zones

Formation	Code	Perf. Top	Perf. Bottom	Date	Method of Isolation	Plug Depth
J SAND	JSND	8251	8286			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	211	200	211	0	VISU
1ST	7+7/8	4+1/2	11.6	8,395	200	8,395	7,845	CALC

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 8175 with 2 sacks cmt on top. CIPB #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIPB #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 7800 ft. with 275 sacks. Leave at least 100 ft. in casing 7775 CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with 575 sacks. Leave at least 100 ft. in casing 4575 CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with 220 sacks. Leave at least 100 ft. in casing 825 CICR Depth

(Cast Iron Cement Retainer Depth)

Set 55 sacks half in. half out surface casing from 315 ft. to 161 ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CHERYL LIGHT

Title: SR. REGULATORY ANALYST Date: \_\_\_\_\_ Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

### Attachment Check List

Att Doc Num	Name
400376844	PROPOSED PLUGGING PROCEDURE
400376845	WELLBORE DIAGRAM
400376846	WELLBORE DIAGRAM

Total Attach: 3 Files

**General Comments**

<b>User Group</b>	<b>Comment</b>	<b>Comment Date</b>

Total: 0 comment(s)