

US ROCKIES REGION

Anadarko Daily Summary Report

Well: UPRR 42 PAN AM 1

Project: COLORADO-WELD

Site: UPRR 42 PAN AM 1

Rig Name No: BASIC 1549/1549

Event: ABANDONMENT

Start Date: 1/23/2013

End Date: 2/14/2013

Spud Date: 12/29/1970

Active Datum: RKB @4,907.00usft (above Mean Sea Level)

UWI: 0/3/N/66/W/29/0/SWNW/6/0/0/0/0/0/0/0

Report No	Report Date	MD (usft)	24 Hr Summary
1	01/23/2013		RU Frontier to pull BS. BS stuck in seating nipple. Could not pull. MIRU Basic 1549. Kill well. ND well head. NU BOP. TOO H & tally tbg. PU 3 7/8" bit, 4 1/2" scraper & TIH w/60 stds. SI. SDFN.
2	01/24/2013		TIH w/scraper to 7800'. TOO H. RU Warrior & set CIBP @ 7775'. Run CBL from 7770' to 7000'. Cmt top 7230'. PU NC/SN & TIH. Hydrotest tbg to 6000 psi while TIH. Found 1 crimped jt. RU Baker & spot 25 sks cmt on top of CIBP. TOO H w/20 stds. SI. SDFN.
3	01/25/2013		TOOH w/tbg. RU Warrior. Shoot 3 squeeze holes (.62") @ 7210'. Set retainer @ 6650'. PU stinger & TIH. space out tbg. RU Halliburton & pump 225 sks cmt. Sting out of retainer. Spot 30 bbls mud to btm of tbg. TOO H. SI. SDFN.
4	01/26/2013		RU Warrior & shoot squeeze holes @ 5105' & 4100'. Set cmt retainer @ 4110'. PU stinger & TIH. Space out tbg. RU Halliburton & cmt w/500 sks cmt. Did not circ thru squeeze holes. Sting out. Circ hole w/drlg mud. LD tbg.
5	01/28/2013		WOO. PU 3 7/8" drill bit, PU tbg. Drill retainer & cmt to 4450'. LD 2 jts tbg. SI. SDFN.'
6	01/29/2013		Drill cmt from 4450' to 4666'. TOO H. Run CBL from 4666' to 4050'. Showed cmt to 4560'. Shoot 3 squeeze holes @ 4420' (.62"). Set retainer @ 4112'. PU stinger & TIH. Circ thru holes @ 1.5 bpm @ 1200 psi. SI. SDFN.
7	01/30/2013		Thaw BOP & tbg. RU Baker Hughes & squeeze with 175 sks G cmt. Top squeeze holes plugged off after pumping 25 bbls cmt. Finish pumping cmt & displace. Sting out & pump 70 bbls to clean well. TOO H & LD tbg. Shoot holes @ 4050'. (See remarks)
8	01/31/2013		Thaw well head. RU Baker Hughes & cmt thru holes @ 4050' w/100 sks G cmt. Did not circ. LD tbg. Cut csg @ 730'. LD csg. After LD 3 jts csg the well started blowing. Control well. Circ well to kill. LD csg. TIH w/ tbg to 630'. Pull tbg to 500'. SI. SDFN.
9	02/01/2013		TIH w/tbg. Drill & circulate thru bridge. TIH to 790'. Circ well & wait on cmt. RU Baker Hughes & set plug from 790' to 500' w/175 sks cmt. LD tbg. SI. SDFN.
10	02/02/2013		TIH to tag cmt @ 640'. The cmt needs to be at least 517'. SI SDFN. Change transmission on rig.
11	02/04/2013		TIH to 635'. RU Baker Hughes & spot 150 sx G cmt. TOO H. Wait 4 hours. TIH. Tag cmt @ 180'. TOO H. ND BOP. RU Warrior & set 8 5/8" CIBP @ 150'. NU BOP. Test CIBP to 1000 psi. OK. ND BOP. RDMO.
12	02/14/2013		Crew travel, Redzone. Dug up casing, cut casing 6' below GL. Tagged @ 126'. Filled casing w 69 bags of 5000# cement. Capped casing with plate containing well info. Backfilled.
13	02/14/2013		TIME : 13:00, ROUTE : N31, WINS: 73892, PROJECT TYPE: P&A, BATT#: 34002563, GATHERER: KMG, STATION: OO8816, LINE : NA, COMMENTS: P&A'D OFFLINE - WELLBORE IS PERMANENTLY ABANDONED