



DE ET OE ES

Document Number:
400399781

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.
 A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen
 Name of Operator: PDC ENERGY INC Phone: (303) 8605800
 Address: 1775 SHERMAN STREET - STE 3000 Fax: (303) 8605838
 City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required, Name: PRECUP, JIM Tel: (303) 726-3822
COGCC contact: Email: james.precup@state.co.us

API Number 05-123-07417-00 Well Number: 1
 Well Name: Goodell
 Location: QtrQtr: NENE Section: 21 Township: 7N Range: 66W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WILDCAT Field Number: 99999

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.565132 Longitude: -104.776973
 GPS Data:
 Date of Measurement: _____ PDOP Reading: _____ GPS Instrument Operator's Name: _____
 Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Code	Perf. Top	Perf. Bottom	Date	Method of Isolation	Plug Depth
J SAND	JSND			09/08/1972	CEMENT	7958

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	229	150	229	0	
1ST	7+7/8	4+1/2	11.6	8,105	250	8,105	7,105	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7960 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 7105 ft. to 7000 ft. Plug Type: OPEN HOLE Plug Tagged:
Set 250 sks cmt from 4500 ft. to 3500 ft. Plug Type: OPEN HOLE Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set 200 sacks half in. half out surface casing from 500 ft. to 0 ft. Plug Tagged:

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure
J-Sand
Existing Perforations:
J-Sand: 8019'-8043'
PBTD: 8105'
8 5/8" 24# Casing set @ 229' cemented w/ 150 sx
4 1/2" 11.6# Casing set @ 8105' cemented w/ 250 sx
Procedure:
1)MIRU Roustabout crew
2)Locate and dig up abandon casing and cap
3)Weld on new casing to bring wellhead to ground level
4)MIRU Workover Rig
5)Drill and clean out to TD
6)Set CIBP @ 7960' and dump bail 2 sx cement on top
7)Set 50 sack stub plug at old 4 1/2" casing stub
8)Set 250 sack plug to cover Parkman/Sussex (~3500'-4000')
9)Set 200 sack plug from 500' to surface
10)Dump 10 sacks @ surface

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen

Title: Regulatory Tech Date: _____ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

--

Attachment Check List

Att Doc Num	Name
400399786	WELLBORE DIAGRAM
400399787	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)