

CEI-Gutterson 1-85

County: Weld
api# 0512312383
Field: Eaton

Well Notes:

- Step 1.) Contact landowner 24 hours prior to commencing work on this well.
- 2.) MIRU pulling unit
- 3.) ND Wellhead, NU BOP
- 4.) TOO H w/ 2-3/8" Tubing
- 5.) TIH w/ 2-3/8" tubing and Bit and Scraper
- 6.) MU & TIH w/ 4-1/2" retrievable bridge plug (RBP)
- 7.) Set RBP 50' above Codell Perforations (7286')
- 8.) TOO H w/ 2-3/8" Tubing
- 9.) MU & TIH w/ 4-1/2" retrievable bridge plug (RBP)
- 10.) Set RBP 50' above Niobrara Perforations (6998')
- 11.) TOO H w/ 2-3/8" Tubing
- 12.) RU rig pump & pressure test csg to 500psi for 15 minutes;
- 13.) Chart record & report test result to Denver & State
- 14.) ND BOP, NU Tree & Flowline
- 15.) Turn in final MIT sundry to State