

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400442058

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax: (303) 8605838

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required, Name: HICKEY, MIKE Tel: (970) 302-1024

COGCC contact: Email: mike.hickey@state.co.us

API Number 05-123-17224-00

Well Name: WARNER W

Well Number: 14-8

Location: QtrQtr: SENE Section: 14 Township: 2N Range: 66W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.140000 Longitude: -104.737500

GPS Data:

Date of Measurement: 06/24/2010 PDOP Reading: 2.3 GPS Instrument Operator's Name: Shantell Kling

Reason for Abandonment: ☐ Dry ☐ Production for Sub-economic ☒ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes ☐ No Estimated Depth: 6515Fish in Hole: ☐ Yes ☒ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Code	Perf. Top	Perf. Bottom	Date	Method of Isolation	Plug Depth
CODELL	CODL	7507	7523			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/2	8+5/8	24	907	630	907	0	
1ST	7+7/8	2+7/8	8.7	7,675	275	7,675	0	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7450 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 200 sks cmt from 6515 ft. to 6464 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set 200 sks cmt from 4500 ft. to 500 ft. Plug Type: OPEN HOLE Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 100 sacks half in. half out surface casing from 857 ft. to 957 ft. Plug Tagged: ☐

Set 10 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure

Codell

Existing Perforations:

Codell: 7507'-7523'

PBTD: 7610'

8 5/8" 24# Casing set @ 907' cemented w/ 630 sx

2 7/8" 8.7# Casing set @ 7675' cemented w/ 275 sx

Procedure:

1)MIRU wireline

2)RIH w/CIBP set @ 7450'

3)RIH w/dump bailer and dump 2 sx cement on top of CIBP

4)RIH w/casing cutter, cut & pull casing @ ~6515'

5)TIH set 50 sack plug @ casing stub (6515')

6)TIH to tag stub plug

7)TOH to set 200 sack plug @ Parkman/Sussex (~4500'--5000')

8)TOH and set 100 sack cement plug half in half out of surface casing from 857'-957'

9)Set 10 sx @ top of surface

10)Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: JEnifer Hakkarinen

Title: Regulatory Tech

Date: _____

Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved:

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

Attachment Check List

Att Doc Num	Name
400442065	WELLBORE DIAGRAM
400442066	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)