

## WORKOVER PROCEDURE

WELL NAME: Buckmur B02-14 DATE: 7/24/2013  
LOCATION: Qtr/Qtr: SESW Section: 2 Township: 5N Range: 64W  
COUNTY: WELD STATE: CO API #: 05-123-23291

ENGINEER: Brittany Smyth 7 Day Notice Sent: \_\_\_\_\_  
(Please notify Engineer of any major Do not start operations until: \_\_\_\_\_  
changes prior to work) Notice Expires: \_\_\_\_\_

OBJECTIVE: Annular Fill

WELL DATA: Surface Csg: 8 5/8" 24# 587' KB Elevation: 4624'  
Surface Cmt: 587' GL Elevation: 4612'  
Long St Csg: 4 1/2" 11.6# N80 6934' TD: 6934'  
Long St Cmt: 2646' - TOC PBTD: 6890'  
Long St Date: 11/3/2005

Plug Back (Sand or CIBP): TAG  
Perforation Interval (1): NIO 6512'- 6654'  
Perforation Interval (2): CODELL 6825'- 6836'  
Perforation Interval (3): \_\_\_\_\_

Tubing: 2 3/8" 4.7# J55 @ 6796' Rods: \_\_\_\_\_  
Pump: \_\_\_\_\_  
Misc.: \_\_\_\_\_

PRODUCTION STATUS: Producing - 3.3 BOEPD  
COMMENTS: Base Fox Hills @ 274'

### PROCEDURE:

- 1) MIRU Workover rig, pump & tank.
- 2) Control well with kill fluid
- 3) POOH 2 3/8" tubing
- 4) RIH w/ Bit & Scraper. Tag fill if any. Clean out to PBTD (tally in). TOOH
- 5) RIH w/RBP. Set RBP @ +/-6462', spot 2 sx of sand on top of RBP. Test RBP 2,000psi. TOOH
- 6) Bleed off bradenhead, unland casing
- 7) Trip in 1 1/4" tubing down annular w/ mule shoe to 1900', condition hole.
- 8) RU cement crew, pump 360 sxs 15.8ppg "G" neat cement to cover interval 800'-1800'.
- 9) POOH with 1 1/4" tubing, land casing.
- 10) SI well overnight, run CBL recording new cement depths
- 11) Clean out hole