

VON FELDT 14-12 BRADENHEAD PROCEDURE

- 1 Level location for base beam rig.
- 2 Call Foreman or Field Coordinator before rig up to catch plunger, isolate production equipment, and ask if replacement parts/equipment are requested. Operations need to hook up the Bradenhead pressure and bleed off the pressure before the rig gets on location.
- 3 Check and report surface casing pressure. If surface casing is not accessible at ground level, re-plumb so valve is at ground level.
- 4 Spot a minimum of 25 jts 2-3/8", 6.5#, J-55 EUE TBG for replacement and 135 jts 1-1/4", 2.33#/ft, J-55 10rd IJ for annular cement job.
- 5 MIRU slickline. Fish production equipment as necessary and tag fill. Last tagged depth was 7920' on 2/13/2009 (Bottom J-Sand perf: 7856').
- 6 MIRU WO rig. Kill well, as necessary, with biocide treated fresh water. ND WH. NU BOPE.
- 7 Unseat landing joint and lay down.
- 8 MRIU EMI services. TOOH with 2-3/8" TBG. EMI on TOOH. LD joints with wall loss or penetrations > 35%. Replace joints as necessary. **Keep yellow & blue band tubing. Note joint number and depth of tubing leak(s) on PRODUCTION EQUIPMENT FAILURE REPORT IN OPEN WELLS.
- 9 TIH with 2-3/8" TBG & RBP suitable for 4.5", 11.6#, I-80 casing. Set RBP at 4120'. (Collars at 4096' & 4138').
- 10 Circulate gas out of well and pressure test RBP & CSG to 2000 psi for 15 min. Dump 2 sx sand on top of RBP & TOOH while standing back TBG.
- 11 ND BOPE. ND WH. Unland 4-1/2" casing. NU double entry flange.
- 12 PU 1-1/4", 2.3#/ft J-55 10rd IJ tubing and TIH outside 4-1/2" casing and open hole & tag top of cement (~4016'). Circulate with biocide treated fresh water on TIH to clean annulus.
- 13 MIRU cement services. Pump 200 bbls of drilling mud in annular space down 1-1/4" TBG. Mix and pump cement job as follows: Freshwater spacer, 20 bbls Sodium Metasilicate, 775 sx 15.8 ppg neat Class G cement with ¼#/sx cello-flake. The cement is to be retarded for 125 degF for a six hour pump time. (Attempt to cement from 4000' to 907').
- 14 TOOH with 55 stands and stand back in derrick to end of tubing at +/- 550' and reverse circulate 2 times the tubing volume or until returns clean up.
- 15 Trip out of the hole with tubing and shut in overnight.
- 16 Rig down cementing services.
- 17 Land 4-1/2" CSG. ND double entry flange. NU wellhead. SDFN to WOC.
- 18 MIRU wireline services.
- 19 PU and RIH with CCL-GR-CBL-VDL. Run from 4100' to surface, or the top of cement. RDMO wireline. If the cement is not above 907' then contact engineer.
- 20 PU and TIH with 2-3/8" TBG & retrieving head. Circulate sand off RBP, latch RBP and TOOH standing back TBG & laying down retrieving head and RBP.
- 21 If clean out is not necessary, skip to the next step. PU and TIH with bailer (hydrostatic or bulldog) and clean out to at least 7886'. (Bottom J-Sand perf 7856') TOOH and SB 2-3/8" TBG & LD bailer.

Well needs Bradenhead work completed

Well is to be worked in due to Eagle Window

Well needs gyro survey

Nio top: 7162'; TOC: 4010'

NPV: 321M; No known casing issues

VON FELDT 14-12 BRADENHEAD PROCEDURE

- 22 PU and TIH with NC, XN profile nipple, and 2-3/8" TBG and land well at 7785', which is approximately 1 joint above the top J-Sand perf.
- 23 RU rig lubricator. Broach tubing to XN nipple. RD rig lubricator.
- 24 ND BOPE. NU WH. RDMO WO Rig.
- 25 Clean location and swab if necessary. Notify Foreman or Field Coordinator of completed workover operations and turn well over to production team.

Well needs Bradenhead work completed
Well is to be worked in due to Eagle Window
Well needs gyro survey
Nio top: 7162'; TOC: 4010'
NPV: 321M; No known casing issues