

Hutchison 9-67-3-7 API#0512331711 – P&A Procedure

- 1 Call Foreman or Lead Operator at least 24 hr prior to rig move.
- 2 Provide notice of MIRU to COGCC field inspector as specified in approved Form 6.
- 3 A gyro survey for this well has already been completed.
- 4 Notify IOC when rig moves on location to generate work order for and one call for line locates.
- 5 Prepare location for base beam rig.
- 6 Spot 52 joints of 2-3/8" 4.7# J55 8rd EUE tbg.
- 7 MIRU WO rig. Load well using water and biocide. ND wellhead. NU BOP.
- 8 TIH with tbg open ended to land EOT 1550' in production casing.
- 9 MIRU cementer. Balance 23 sx of 14.0 ppg Type III cement with CaCl₂ blended for 1 hr pump time. (Attempt to cement production casing from 1550' to 1150').
- 10 TOO H with 23 jts of 2-3/8" tbg. Circulate 2x tubing volume or until cement cleans up and sb tbg.
- 11 Wait 1 hr for cement to set.
- 12 TIH with 10 jts of 2-3/8" tbg and tag cement at ~1150'. If cannot tag near this point, contact engineering for further instructions.
- 13 PUH to 125'. Balance 7 sx of 14.0 ppg Type III cement with CaCl₂ blended for 1 hr pump time. (Attempt to cement production casing from 125' to surface).
- 14 NOTE: During the job, well site supervisor should instruct the cementing contractors to e-mail all job reports/invoices to Sabrina Frantz.
- 15 TOO H and lay down all tbg.
- 16 Top off casing with cement to 5' below grade.
- 17 RDMO cement company, RDMO WO rig.
- 18 Have excavation contractor notify One-Call to clear for digging around wellhead.
- 19 Excavate hole around surface casing of sufficient size and depth to allow welder to cut off 8-5/8" surface casing at least 5' below ground level.
- 20 Have welder cut off 8-5/8" surface casing at least 5' below ground level.
- 21 Spot weld on steel marker plate. (Note: marker shall be labeled with well name and number, legal location (¼ ¼ description) and API number.
- 22 Have excavation contractor back fill hole with native material. Clean up location and have leveled to plant any vegetation required.
- 23 Well site supervisor turn all paper copies of cementing reports/invoices and logs in to Sabrina Frantz.
- 24 Submit Form 6A to COGCC. Provide "As Plugged" wellbore diagram identifying the specific plugging completed.