



GELVIN 24-14 PLUGGING PROCEDURES
API # 05-125-09155

PU & RIH w/ 4.5" CIBP & CCL. Correlate to CCL. Set CIBP @ 2425'. RIH w/ bailer & set 2 sks cement on CIBP. LD bailer. Load casing w/ fresh water. PU & RIH w/ perforating gun & perf well @ 460' w/ 2 shots. Break circ. Mix & pump down 4-1/2", 50 sks cement, get good cement returns up 7" csg @ surface to catch tank. SI well.. Cut off csg. 6' below GL & weld on cap.