

Koch Exploration Company LLC
Plug and Abandonment Procedure
Ivory #2-34

Pertinent Information

API Number: 05-103-09975-00

Well Location: 1700' FSL 2054' FEL
Section 34, Township 2 North, Range 97 West
Rio Blanco County, Colorado

Elevation: 5684' GL, 5697' KB (13' AGL)

TD: 2,299'

Casing: 7" 20# J55 Surface Casing set at 303', cmt to surface 2/85 sx
4 ½" 9.5# J55 Long String set at 2058', cmt to surface w/355 sx

Tubing: 62 jts, 2 3/8" J55
78 5/8" rods

Perforations: Wasatch
984-1002', 1395-1405', 1408-1416', 1419-1426'

Procedure

1. MIRU workover rig. Trip out with rods. Install BOP and trip out with tubing.
2. Set cement retainer 940'.
- ~~3.~~ Rig up cement company and pump 150 sx of class G cement below retainer and into perforations.
4. Spot 5 sx cement on top of CR.
5. Pull up 100' and fill well bore with 8.4 ppg fluid treated with corrosion inhibitor
6. Pull up and place a balanced plug from 600' to surface. POOH.
7. Remove BOP and cut off wellhead. Top off cement in both casing strings. Install dry hole marker.
8. Rig down workover rig. Clean up location.
9. Reclaim location as per APD/State of Colorado requirements.