



## Exploration and Production Well P&A Procedure

Wellname **TW 8-36**  
Location **36-T6S-R96W**  
Field **Grand Valley**  
County **Garfield, CO**  
API **05-045-06707**  
ELEV **5485 ft**  
Footages **1509 FSL 689 FWL**

Prepared By: Tony Franzone  
office phone: 970-285-9377  
cell phone: 970-589-1454

Revision Date:  
2/4/2014

Casing: 8-5/8" 24# - 296-ft  
4-1/2" 11.6# - 2,024-ft  
Current Top of Cement: 783-ft CBL (RMWS 08/30/1990)  
Top of Wasatch: Surface

**Purpose: Plug to abandon well**

Zone: **All Perforations**

Existing  
Perforations:

<u>Depth</u>	<u>Holes</u>
--------------	--------------

1,398'-1,540'	34
1,856'-1,894'	27

---

61 total

### Proposed Procedure

- 1 Notify COGCC 48 hrs prior to start of activity via electronic Form 42
- 2 Previously TA'ed, set CIBP at 1,365-ft and dump bailed 2 sacks of cement, 06/2009, pressure test, pass
- 3 Perforate 4-1/2" casing below surface casing shoe
- 4 Place a cement plug to cover 4-1/2" backside from perforations to 100-ft into 8-5/8", and leaving 100-ft cement in 4-1/2", with a 30% open hole cement excess
- 5 Cut off 8-5/8" and 4-1/2" casing to 4-ft below ground level
- 6 Apply a 50-ft cement plug from surface in 4-1/2" - 8-5/8" annulus
- 7 Place a 50-ft surface cement plug inside 4-1/2" casing
- 8 Weld in place dryhole marker
- 9 Backfill cellar
- 10 Abandon flowlines per Rule 1103, file electronic Form 42