

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 400600173			
Date Received:			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120	Contact Name: CHERYL LIGHT
Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP	Phone: (720) 929-6461
Address: P O BOX 173779	Fax: (720) 929-7461
City: DENVER State: CO Zip: 80217-	Email: CHERYL.LIGHT@ANADARKO.COM
For "Intent" 24 hour notice required, Name: MONTOYA, JOHN Tel: (970) 3974124	
COGCC contact: Email: john.montoya@state.co.us	

API Number 05-123-09416-00	Well Number: 1
Well Name: GLEN L HANSEN GAS UNIT B	
Location: QtrQtr: SWSW Section: 16 Township: 2N Range: 66W Meridian: 6	
County: WELD	Federal, Indian or State Lease Number:
Field Name: WATTENBERG	Field Number: 90750

☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.134500	Longitude: -104.787440
GPS Data:	
Date of Measurement: 09/25/2008	PDOP Reading: 2.9
GPS Instrument Operator's Name: Cody Mattson	
Reason for Abandonment: <input type="checkbox"/> Dry <input checked="" type="checkbox"/> Production for Sub-economic <input type="checkbox"/> Mechanical Problems	
<input type="checkbox"/> Other	
Casing to be pulled: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	Estimated Depth: 190
Fish in Hole: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Details:	

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7915	7960			
Total: 1 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	278	200	278	0	VISU
1ST	7+7/8	4+1/2	10.5/11.6	8,070	200	8,070	7,070	CALC
S.C. 1.1				771	200	771	200	CALC

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7860 with 2 sacks cmt on top. CIPB #2: Depth 80 with 25 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 40 sks cmt from 290 ft. to 80 ft. Plug Type: STUB PLUG Plug Tagged: ☒

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 6810 ft. with 100 sacks. Leave at least 100 ft. in casing 6840 CICR Depth

Perforate and squeeze at 4370 ft. with 650 sacks. Leave at least 100 ft. in casing 4390 CICR Depth

Perforate and squeeze at 855 ft. with 430 sacks. Leave at least 100 ft. in casing 885 CICR Depth

(Cast Iron Cement Retainer Depth)

Set 40 sacks half in. half out surface casing from 290 ft. to 80 ft. Plug Tagged: ☐

Set 25 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Perforate and squeeze at 7050' / 6810' ft. with 100 sacks Leave at least 100 ft. in casing 6840' CICR Depth
Perforate and squeeze at 5250' / 4370' ft. with 650 sacks Leave at least 100 ft. in casing 4390' CICR Depth
Perforate and squeeze at 1525' / 855' ft. with 430 sacks Leave at least 100 ft. in casing 885' CICR Depth

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: CHERYL LIGHT

Title: SR. REGULATORY ANALYST Date: _____ Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

COA Type **Description**

COA Type	Description

Attachment Check List

Att Doc Num

Name

400600178	PROPOSED PLUGGING PROCEDURE
400600180	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

--	--	--

Total: 0 comment(s)