

FORM
6Rev
12/05

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Replug By Other Operator

Document Number:

400599231

Date Received:

04/30/2014

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: EILEEN ROBERTS

Name of Operator: NOBLE ENERGY INC

Phone: (303) 228-4330

Address: 1625 BROADWAY STE 2200

Fax: (303) 228-4286

City: DENVER State: CO Zip: 80202

Email: eroberts@nobleenergyinc.com

For "Intent" 24 hour notice required,

Name: Rains, Bill

Tel: (970) 590-6480

COGCC contact:

Email: bill.rains@state.co.us

API Number 05-123-10878-00

Well Name: MOTIS

Well Number: 1

Location: QtrQtr: NWNE Section: 1 Township: 9N Range: 58W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WILDCAT

Field Number: 99999

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.785985

Longitude: -103.809914

GPS Data:

Date of Measurement: PDOP Reading: GPS Instrument Operator's Name:

Reason for Abandonment: ☐ Dry ☐ Production for Sub-economic ☐ Mechanical Problems☒ Other Re-enter well, set plug, PA well w/ new cementCasing to be pulled: ☐ Yes ☐ No Estimated Depth:Fish in Hole: ☐ Yes ☐ No If yes, explain details belowWellbore has Uncemented Casing leaks: ☐ Yes ☒ No If yes, explain details below

Details: See Attached: Procedure of re-entry and new PA

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth

Total: 0 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24.0	98	60	98	0	VISU

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set	50	sks cmt from	5300	ft. to	5200	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input type="checkbox"/>
Set	50	sks cmt from	3000	ft. to	2900	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input type="checkbox"/>
Set	307	sks cmt from	830	ft. to	0	ft.	Plug Type:	OPEN HOLE	Plug Tagged:	<input type="checkbox"/>
Set		sks cmt from		ft. to		ft.	Plug Type:		Plug Tagged:	<input type="checkbox"/>
Set		sks cmt from		ft. to		ft.	Plug Type:		Plug Tagged:	<input type="checkbox"/>

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

PROCEDURE:

- 1) Survey and locate abandoned well, mark with stake
- 2) Excavate to expose top of surface casing
- 3) Weld 2" collar to top of 8 5/8" surface casing cap. Make up to collar, pneumatic drill with non-sparking bit. Drill out cap venting possible trapped gas.
- 4) Once verified that no gas exists beneath top of surface casing plate, cut off surface casing below plate with torch, dress up smooth.
- 5) Butt weld 8 5/8" casing to dressed cut, bringing threaded end of casing to ground level.
- 6) Make up to 8 5/8" casing, one 8 5/8" collar and 8 5/8" starter well head
- 7) NU flange adaptor and 5k BOP, test BOP.
- 8) NU and RIH with 6 7/8" cone bit, PU 2 7/8" drill collar, 2 7/8" 8.7# tubing, and TIW valve
- 9) Drill out first cement plug inside surface casing, roll hole clean. Verify top of next cement plug inside of surface casing by tagging.
- 10) If unable to verify isolation of surface casing with tag of cement plug, set RBP inside surface casing
- 11) Once isolation of surface casing is established, either with tagging of surface plug or setting of RBP, pressure test surface casing to 200psi
- 12) After pressure test of surface casing, retrieve RBP or continue drill out of cement plug under surface casing shoe.
- 13) Assume pressure under surface casing shoe, roll hole with kill fluid until well dead, or blow down.
- 14) Continue RIH, cleaning out with drilling mud or water to 5400'
- 15) TOO H with cone bit, drill collars, and 2 7/8" tubing.
- 16) PU and RIH with mule shoe and 2 7/8" tubing to 5300'.
- 17) RU cement crew and pump a balanced plug of 50 sks 15.8 ppg Class G "neat" cement
- 18) POOH to 3000' and pump balanced plug of 50 sks 15.8 ppg Class G "neat" cement
- 19) POOH to 830' (150' below deepest water well @ 680')
- 20) RU cement crew and pump 307 sxs of 15.8ppg Class G "neat" cement bring cement to surface
- 21) POOH with 2 7/8" tubing. Wait 4 hrs, and tag TOC. If cement has fallen, top off back to surface
- 22) Let cement set over night, verify cement has not settled and is still at surface. RDMO
- 23) Excavate around wellhead to 8' below grade, cut off 8 5/8" casing, weld on cap
- 24) Backfill hole and reclaim surface to original conditions

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Eileen Roberts
Title: Regulatory Analyst I Date: 4/30/2014 Email: eroberts@nobleenergyinc.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: SUTPHIN, DIRK Date: 5/8/2014

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: 11/7/2014

COA Type	Description
	1) Provide 48 hour notice of MIRU via electronic Form 42. 2) Submit Form 42(s) - OFFSET MITIGATION COMPLETED, in accordance with DJ Basin Horizontal Offset Policy. 3) Submit Form 6 – Subsequent Report of Abandonment within 30 days of plugging in accordance with Rule 311. 4) Provide well location GPS coordinates on Subsequent Report of Abandonment in accordance with COGCC As-Built Location Policy and Rule 215.
	1) Operator will submit a Form 4 to report date Final Reclamation will commence. Final reclamation should begin as soon as practicable.

Attachment Check List

Att Doc Num	Name
2157668	SURFACE OWNER CONSENT
400599231	FORM 6 INTENT SUBMITTED
400599555	WELLBORE DIAGRAM
400599557	WELLBORE DIAGRAM
400599560	PROPOSED PLUGGING PROCEDURE
400599584	LOCATION PHOTO

Total Attach: 6 Files

General Comments

User Group	Comment	Comment Date
Permit	Oper. submitted surface owner consent.	5/1/2014 10:52:31 AM
Permit	Req'd surface owner consent. Final Reclamation Inspection #200100235 from 11/2006 in well file.	5/1/2014 7:58:21 AM

Total: 2 comment(s)