

FORM

6

Rev
12/05

State of Colorado

Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Replug By Other Operator

Document Number:

400616950

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required.

Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120

Contact Name: CHERYL LIGHT

Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP

Phone: (720) 929-6461

Address: P O BOX 173779

Fax: (720) 929-7461

City: DENVER State: CO Zip: 80217-

Email: CHERYL.LIGHT@ANADARKO.COM

For "Intent" 24 hour notice required,

Name: MONTOYA, JOHN

Tel: (970) 3974124

COGCC contact:

Email: john.montoya@state.co.us

API Number 05-123-10055-00

Well Name: UPRR 38 PAN AM GAS UNIT H

Well Number: 2

Location: QtrQtr: NWNW Section: 15 Township: 2N Range: 66W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.141680

Longitude: -104.768029

GPS Data:

Date of Measurement: 05/06/2014

PDOP Reading: 2.2

GPS Instrument Operator's Name: BART PFEIFER

Reason for Abandonment:

☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☐ Yes☒ No

Estimated Depth:

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details: This well was originally abandoned in 1995. Well is to be re-entered and additional cement added to isolate the Niobrara, Sussex, and Fox Hills formations. Casing leaks at 830', 1346' and 2169' were cemented with a total of 450 sacks in December 1994.

As-built well location GPS data will be submitted on the Form 6 Subsequent Report of Abandonment.

Purpose is to re-enter and adequately re-plug prior to hydraulic stimulation of proposed horizontal well per DJ Basin Offset Policy

dated December 16, 2013.

Closed loop system will be used.

Re-entry and re-plug procedures attached.

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7910	7966	08/15/1995	B PLUG CEMENT TOP	7880

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	297	250	297	0	VISU
1ST	7+7/8	4+1/2	10.5/11.6	8,087	200	8,087	7,212	CALC

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 100 with 23 sacks cmt on top. CIPB #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIPB #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 90 sks cmt from 2200 ft. to 600 ft. Plug Type: CASING Plug Tagged: ☒
Set 60 sks cmt from 410 ft. to 100 ft. Plug Type: CASING Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at 7190 ft. with 170 sacks. Leave at least 100 ft. in casing 6800 CICR Depth
Perforate and squeeze at 4460 ft. with 130 sacks. Leave at least 100 ft. in casing 4290 CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐
Set 23 sacks at surface
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☒ No
Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____
*Wireline Contractor: _____ *Cementing Contractor: _____
Type of Cement and Additives Used: _____
Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

PLUG AND ABANDONMENT PROCEDURE WILL NOT FIT IN SPACE PROVIDED. (SEE ATTACHED).

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: CHERYL LIGHT
Title: SR. REGULATORY ANALYST Date: _____ Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
400616965	OTHER
400616966	PROPOSED PLUGGING PROCEDURE
400616967	SURFACE AGRMT/SURETY
400616974	WELLBORE DIAGRAM

Total Attach: 4 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)