

## WORKOVER PROCEDURE

**WELL NAME:** LATHAM 02-44 **DATE:** 6/10/2014  
**LOCATION:**  
Qtr/Qtr: SE/SE Section: 2 Township: 4N Range: 65W  
Footages: 660' FSL & 660' FEL  
**COUNTY:** WELD **STATE:** CO **API #:** 05-123-15211

**ENGINEER:** JONATHAN POMERANTZ 7 Day Notice Sent: \_\_\_\_\_  
(Please notify Engineer of any major Do not start operations until: \_\_\_\_\_  
changes prior to work) Notice Expires: \_\_\_\_\_

**OBJECTIVE:** P&A

**WELL DATA:** Surface Csg: 8 5/8" 24# @ 417' KB Elevation: 4716'  
Surface Cmt: 200 sx GL Elevation: 4702'  
Long St Csg: 4 1/2" 11.6# @ 7167' TD: 7200'  
Long St Cmt: 200 sx PBTD: 7075'  
Long St Date: 10/17/1991

Plug Back (Sand or CIBP): \_\_\_\_\_  
Perforation Interval (1): Niobrara Perforations 6732' - 6927'  
Perforation Interval (2): Codell Perforations 7024' - 7038'  
Perforation Interval (3): \_\_\_\_\_  
Tubing: 2 3/8" 4.7# J-55 tbg @ 7000' Rods: \_\_\_\_\_  
Pump: \_\_\_\_\_  
Misc.: \_\_\_\_\_

**PRODUCTION STATUS:** \_\_\_\_\_  
**COMMENTS:** \_\_\_\_\_

### PROCEDURE:

- 1) MIRU Workover rig, pump & tank.
- 2) POOH w/ 2 3/8" tbg and lay down.
- 3) RU WL. RIH w/ CIBP. Set CIBP @ 6682', dump bail 2 sx of cement on top.
- 4) Unland casing. Cut casing off @ 4500'. POOH with casing laying down on trailer.
- 5) RIH w/ workstring to pump 125 sx stub/shoe plug where csg was pulled. If maintain circulation, no need to tag plug.
- 6) Pump 50 sx courtesy plug @ 2500'. POOH w/ workstring to 520'. Pump 200 sx shoe plug. Cement to surface.
- 7) SI, WOC. RIH. Tag shoe plug. Add cement if needed.
- 8) Cut surface casing off 6'-8' below ground.
- 9) Clean up location. Reclaim location. RDMO.