

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Replug By Other Operator

Document Number:

400639464

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 96155

Contact Name: James Kopp

Name of Operator: WHITING OIL AND GAS CORPORATION

Phone: (303) 357-1410

Address: 1700 BROADWAY STE 2300

Fax: (303) 390-4292

City: DENVER State: CO Zip: 80290

Email: james.kopp@whiting.com

For "Intent" 24 hour notice required,

Name: Rains, Bill

Tel: (970) 590-6480

COGCC contact:

Email: bill.rains@state.co.us

API Number 05-123-20474-00

Well Name: WALKER

Well Number: 3

Location: QtrQtr: NWNW Section: 31 Township: 10N Range: 58W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: TERRACE SOUTH

Field Number: 81550

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.799964

Longitude: -103.914918

GPS Data:

Date of Measurement:

PDOP Reading:

GPS Instrument Operator's Name:

Reason for Abandonment:

☐ Dry☐ Production for Sub-economic☐ Mechanical Problems☒ Other Re-enter to re-plug

Casing to be pulled:

☐ Yes☐ No

Estimated Depth:

Fish in Hole:

☐ Yes☐ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☐ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation

Perf. Top

Perf. Btm

Abandoned Date

Method of Isolation

Plug Depth

Total: 0 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	350	0	350	0	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 60 sks cmt from 5700 ft. to 5500 ft. Plug Type: OPEN HOLE Plug Tagged: ☒

Set 60 sks cmt from 1700 ft. to 1500 ft. Plug Type: OPEN HOLE Plug Tagged: ☒

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 110 sacks half in. half out surface casing from 350 ft. to 0 ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Re-Plug and Abandon Procedure

1. Notify COGCC at least 48-hours prior to the start of operations using a Form 42. Verify with James Kopp that this is completed prior to moving the rig in.
2. The following is a procedure to drill out existing cement plugs and re-plug in order to properly isolate the Walker 3 well. Take GPS coordinates of well location. Send information to: James.Kopp@whiting. James Kopp com (303) 357-14103.
3. MIRU Workover Rig. Mob-in pump, swivel, tank, and 2-7/8" PH-6 workstring. NU 7-1/16" 5K BOP w/ 2-7/8" pipe rams on top and blind rams on bottom, pressure test high and low. PU full gauge 7-7/8" bit & TIH on 2-7/8" tubing.
4. Drill out existing cement plugs down to approximately 1,410 ftKB.
5. Clean out to approximately 5,800 ftKB.
6. Once depth has been reached, TOOH with 2-7/8" workstring standing back.
7. MIRU gyro equipment. PU tools and RIH while logging down to 5,800 ftKB. POOH while logging, LD tools.
8. MIRU cement crew. Pressure test surface lines to 2,000psi. Mix and pump 60 sks, API Class G, 1.15 cu-ft/sk, 15.8 ppg cement, balancing plug at 5,700 ftKB. TOOH with 2-7/8" workstring standing back. Let cement cure overnight.
9. TIH with 2-7/8" workstring. Tag TOC with EOT, record depth.
10. MIRU cement crew. Pressure test surface lines to 2,000psi. Mix and pump 60 sks, API Class G, 1.15 cu-ft/sk, 15.8 ppg cement, balancing plug at 1,700 ftKB. TOOH with 2-7/8" workstring standing back. Let cement cure overnight.
11. TIH with 2-7/8" workstring. Tag TOC with EOT, record depth.
12. MIRU cement crew. Pressure test surface lines to 2,000psi. Mix and pump 110 sks, API Class G, 1.15 cu-ft/sk, 15.8 ppg cement, balancing plug from 350 ftKB to surface. TOOH with 2-7/8" workstring, LD on float.
13. Cut off WH to 5' below GL and fill hole.
14. Weld on cap with plugging information plate. Backfill cellar.
15. Reclaim disturbed surface.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Kristi McRedmond

Title: Regulatory Technician

Date: _____

Email: regulatory@petro-fs.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
400639550	OTHER
400639551	WELLBORE DIAGRAM
400639554	WELLBORE DIAGRAM
400639555	LOCATION PHOTO
400639556	OTHER

Total Attach: 5 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)