

WORKOVER PROCEDURE

WELL NAME: COX 08-01 DATE: 7/15/2014

LOCATION: Qtr/Qtr: NE/NW Section: 8 Township: 4N Range: 64W

Footages: 660' FNL & 1980' FWL

COUNTY: WELD STATE: CO API #: 05-123-11796

ENGINEER: JONATHAN POMERANTZ 7 Day Notice Sent:
(Please notify Engineer of any major changes prior to work) Do not start operations until:
Notice Expires:

OBJECTIVE: P&A

WELL DATA: Surface Csg: 8 5/8" 24# @ 303' KB Elevation: 4779'
Surface Cmt: 130 sx GL Elevation: 4768'
Long St Csg: 4 1/2" 11.6# @ 7089' TD: 7148'
Long St Cmt: 160 sx PBTD: 7040'
Long St Date: 5/17/1984

Plug Back (Sand or CIBP):
Perforation Interval (1): Codell Perforations 6976' - 6990'
Perforation Interval (2):
Perforation Interval (3):
Tubing: 2 3/8" 5.95# ? tbg @ 6953' Rods:
Pump:
Misc.:

PRODUCTION STATUS:
COMMENTS:

PROCEDURE:

- 1) MIRU Workover rig, pump & tank.
2) POOH w/ 2 3/8" tbg and lay down.
3) RU WL. RIH w/ CIBP. Set CIBP @ 6926', dump bail 2 sx of cement on top.
4) Unland casing. Cut casing off @ 2500'. POOH with casing laying down on trailer.
5) RIH w/ workstring to pump 100 sx stub plug where csg was pulled. If maintain circulation, no need to tag plug.
6) POOH w/ workstring to 560'. Pump 225 sx shoe plug. Cement to surface.
7) SI, WOC. RIH. Tag shoe plug. Add cement if needed.
8) Cut surface casing off 6'-8' below ground.
9) Clean up location. Reclaim location. RDMO.