



Exploration and Production

Well P&A Procedure

Wellname **PA 421-6**
Location **NENW 6-7S-95W**
Field **Parachute**
County **Garfield, CO**
API **05-045-10241**
ELEV **5,401'**
Footages **745 FNL 1438 FWL**

Prepared By: Tony Franzone
office phone: 970-285-9377
cell phone: 970-589-1454

Revision Date:
8/22/2014

Casing: 9-5/8" 32.3#, H-40, - 1,102-ft
4-1/2" 11.6#, I-80, - 6,746-ft
Current Top of Cement: 3,138-ft CBL (RMWS 11/10/2004)

Purpose: Plug to abandon well

Zone:	All Perforations	
Existing Perforations:	<u>Depth</u>	<u>Holes</u>
	4777 - 5000	20
	5128 - 5485	19
	5569 - 5796	19
	5884 - 6186	18
	6317 - 6623	18
		<hr/>
		94 total

Proposed Procedure

- 1 Notify COGCC 48 hrs prior to start of activity via electronic Form 42
- 2 Set CIBP + 2 sks cement at 4725' ft in 4-1/2" casing
- 4 Set CIBP at 1200' in 4-1/2" casing, perforate 4-1/2" casing with 3 holes phased 120°, at 1150'
- 5 Place a cement plug to cover 4-1/2" backside from perforations to 50' into 9-5/8", and leaving 50' cement in 4-1/2", with a 30% open hole cement excess
- 7 Apply a 50-ft cement plug from surface in 4-1/2" - 9-5/8" annulus
- 8 Place a 50-ft surface cement plug inside 4-1/2" casing
- 9 Weld in place dryhole marker
- 10 Backfill cellar
- 11 Properly abandon flowlines per Rule 1103. File electronic Form 42 after flowline abandonment is complete