

Butterball H30-27 – Bradenhead

- 1 This well already has a gyro.
- 2 Call Wattenberg IOC (970-506-5980) at least 24 hrs prior to rig move. If not already completed, request that they catch and remove plunger, isolate production equipment and remove any automation equipment prior to the rig showing up. Install perimeter fence as needed.
- 3 MIRU SL. Fish plunger if necessary and tag PBMD (Should be 7500').
- 4 Prepare location for base beam rig.
- 5 Spot 25 jts of 2-3/8" 4.7# J-55 8RD EUE tbg.
- 6 Spot 57 jts of 1-1/4" 2.33# J-55 10rd IJ tbg.
- 7 Well needs new 5000 psi rated WH. Ensure all valves, fittings, and plugs on wellhead are rated to 5000 psi. Follow WH change out specifications in Step 26.
- 8 MIRU WO rig. Kill well with fresh water and biocide. ND WH, NU BOP.
- 9 PU tbg to break any possible sand bridges. Do not exceed 80% of tubing tensile strength, or 57,384 lb. LD landing jt.
- 10 Unseat tbg hanger. Install rubber wiper in stripping head.
- 11 MIRU EMI equipment. TOO H with 2-3/8" tbg. EMI tbg while TOO H. Lay down jts with wall loss or penetrations >35%. Replace jts as necessary. Keep yellow and blue band tbg. Note jt number and depth of tubing leak(s) on production equipment failure report in OpenWells. Clearly mark all junk (red band) tbg sent to yard.
- 12 PU and TIH with 200 jts of 2-3/8" tbg with 4.5" RBP (4.5" 11.6# M-80). Set RBP at +/- 6300' (Collars at 6272' and 6314'). Spot 2 sx sand on top of RBP. TOO H. Stand back tbg.
- 13 Pressure test RBP to 1000 psi for 15 minutes. If pressure test passes, proceed.
- 14 ND BOP, ND tbg head. Unland 4-1/2" 11.6# M-80 csg (Do not exceed 130,000-lb pull weight). NU double entry flange, NU BOP.
- 15 PU and TIH with 57 jts of 1-1/4" tbg outside 4-1/2" csg to +/- 1700'.
- 16 Circulate and condition hole with ~79 bbls of drilling mud with rig pump (1.5x annular volume from 1700'), or until well is completely dead. Spot 40 bbls of 10 ppg drilling mud.
- 17 TOO H with 7 jts 1-1/4" tbg to 1500'.
- 18 MIRU Cement company. Commence pumping cement job consisting 5 bbl fresh water, 20 bbl sodium metasilicate and 5 bbl fresh water; 240 sx of Type III with 1/4 lb/sk cello-flake mixed at 14.8 ppg and 1.33 cf/sk blended for a 3 hr pump time (cement from 1500' to 650').
- 19 TOO H with 32 jts of 1-1/4" tbg to +/- 500' and circulate 2x tbg volume to clean up.
- 20 TOO H with remaining 1-1/4" tbg and LD.
- 21 Break lines and clean up with fresh water. RMDO cement company.
- 22 ND BOP, ND double entry flange, re-land 4-1/2" csg. NU BOP.
- 23 Leave well SI for minimum of 24 hours.

No Stips

NPV \$295M

Bradenhead

SX top: 4325'

FHM: 1170'

- 24 MIRU WL and run CCL-GR-CBL-VDL from 1700' to 0' (cement should be from +/- 1500' to 650'). If Fox Hills plug is not above 650', contact engineering for further instructions. Email logs to engineering and DJVendors@anadarko.com. RDMO WL.
- 25 Pressure test casing to 1000 psig. If pressure test does not hold, call engineering.
- 26 ND BOP. Install new 5000 psi threaded tubing head with 7-1/16" flanged top, 7-1/16" flanged 5000 psi tubing head adaptor with 2-1/16" studded top, 2-1/16" flanged 5000 psi master valve, flanged 5000 psi 2-3/8" plunger lubricator (side outlets threaded). All valves, fittings, plugs on well head need to be rated for 5000 psi.
- 27 Pressure test the tubing head from below the tubing head through the master valve to 5000 psi with hydro tester. NU BOP.
- 28 TIH with 2-3/8" tbg and retrieving head to tag sand above RBP at +/- 6300'. Circulate sand off RBP, latch onto RBP and TOOH. SB tbg, LD RBP.
- 29 PU and TIH with 234 jts 2-3/8" tbg and land at +/- 7300' (1 jt above top Codell perf).
- 30 ND BOP, NU WH.
- 31 RDMO WO rig. Return well to production team.
- 32 Clean location and swab well back to production. Notify field foreman/field coordinator of finished work and turn well back over to production team.

No Stips
NPV \$295M
Bradenhead
SX top: 4325'
FHM: 1170'

Existing

KB=13'

Proposed

Butterball H30-27
API: 05-123-26199

