

FORM  
6Rev  
12/05

## State of Colorado

## Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400690045

Date Received:

09/17/2014

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322

Contact Name: Jeremy Gilbert

Name of Operator: NOBLE ENERGY INC

Phone: (303) 345-8939

Address: 1625 BROADWAY STE 2200

Fax:

City: DENVER State: CO Zip: 80202

Email: jgilbert@nobleenergyinc.com

For "Intent" 24 hour notice required,

Name: Carlile, Craig

Tel: (970) 629-8279

COGCC contact:

Email: craig.carlile@state.co.us

API Number 05-123-14526-00

Well Name: VICTOR E GOODHARD

Well Number: 22-1

Location: QtrQtr: NESW Section: 22 Township: 3N Range: 65W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.209078

Longitude: -104.652140

GPS Data:

Date of Measurement: 07/06/2006

PDOP Reading: 3.1

GPS Instrument Operator's Name: David Gipson

Reason for Abandonment: ☐ Dry ☒ Production for Sub-economic ☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 2500

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7100	7110			

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12	8+5/8	24	510	350	510	10	VISU
1ST	7+7/8	3+1/2	9.3	7,291	225	7,291	6,252	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7050 with 2 sacks cmt on top. CIPB #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIPB #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 100 sks cmt from 2550 ft. to 2350 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 260 sacks half in. half out surface casing from 700 ft. to 0 ft. Plug Tagged: ☒

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

#### PROCEDURE:

- 1) MIRU Workover rig, pump & tank.
- 2) POOH w/ 2 1/16" tbg and lay down.
- 3) RU WL. RIH w/ CIBP. Set CIBP @ 7050', dump bail 2 sx of cement on top.
- 4) Unland casing. Cut casing off @ 2500'. POOH with casing laying down on trailer.
- 5) RIH w/ workstring to pump 100 sx stub plug where csg was pulled. If maintain circulation, no need to tag plug.
- 6) POOH w/ workstring to 700'. Pump 260 sx shoe plug. Cement to surface.
- 7) SI, WOC. RIH. Tag shoe plug. Add cement if needed.
- 8) Cut surface casing off 6'-8' below ground.
- 9) Clean up location. Reclaim location. RDMO.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Stephanie Dionne

Title: Base Production Tech Date: 9/17/2014 Email: sdionne@nobleenergyinc.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: SCHLAGENHAUF, MARK Date: 10/2/2014

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_ Expiration Date: 4/1/2015

<u>COA Type</u>	<u>Description</u>
	1) Submit Form 42 electronically to COGCC 48 hours prior to MIRU. 2) If unable to pull casing below 2400' contact COGCC for plugging modifications. 3) For 700' plug: pump plug and displace, shut-in, WOC 4 hours and tag plug – must be 460' or shallower. If shoe plug not circulated to surface then place 10 sx inside casing at surface. Leave at least 100' for each plug. 4) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete. 5) Please submit gyro survey data with Form 6 (s) Subsequent Report of Abandonment.

### **Attachment Check List**

<u>Att Doc Num</u>	<u>Name</u>
400690045	FORM 6 INTENT SUBMITTED
400690103	WELLBORE DIAGRAM
400690108	PROPOSED PLUGGING PROCEDURE
400690109	WELLBORE DIAGRAM

Total Attach: 4 Files

### **General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Permit	Well Completion Report Dated 3/26/1990.	9/25/2014 4:06:33 PM

Total: 1 comment(s)