

State of Colorado
Oil and Gas Conservation Commission1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

DE	ET	OE	ES
Document Number: 400809375			
Date Received:			

SUNDRY NOTICE

Submit a signed original. This form is to be used for general, technical and environmental sundry information. For proposed or completed operations, describe in full in Comments or provide as an attachment. Identify Well by API Number; identify Oil and Gas Location by Location ID Number; identify other Facility by Facility ID Number.

OGCC Operator Number:	47120	Contact Name	Cheryl Light
Name of Operator:	KERR MCGEE OIL & GAS ONSHORE LP		Phone: (720) 929-6461
Address:	P O BOX 173779		Fax: (720) 929-7461
City:	DENVER	State:	CO Zip: 80217-3779 Email: cheryl.light@anadarko.com

Complete the Attachment
Checklist

OP OGCC

API Number :	05-	123	20737	00	OGCC Facility ID Number:	262245
Well/Facility Name:	STIEBER			Well/Facility Number:	12-24A	
Location	QtrQtr:	NWSW	Section:	24	Township:	1N Range: 67W Meridian: 6
County:	WELD		Field Name:	WATTENBERG		
Federal, Indian or State Lease Number:						

Survey Plat		
Directional Survey		
Srfc Eqpmt Diagram		
Technical Info Page		
Other		

CHANGE OF LOCATION OR AS BUILT GPS REPORT

☐ Change of Location * ☐ As-Built GPS Location Report ☐ As-Built GPS Location Report with Survey

* Well location change requires new plat. A substantive surface location change may require new Form 2A.

SURFACE LOCATION GPS DATA Data must be provided for Change of Surface Location and As Built Reports.

Latitude _____ PDOP Reading _____ Date of Measurement _____
Longitude _____ GPS Instrument Operator's Name _____

LOCATION CHANGE (all measurements in Feet)

Well will be: _____ (Vertical, Directional, Horizontal)

Change of **Surface** Footage **From** Exterior Section Lines:Change of **Surface** Footage **To** Exterior Section Lines:Current **Surface** Location **From** QtrQtr **NWSW** Sec **24**New **Surface** Location **To** QtrQtr _____ Sec _____Change of **Top of Productive Zone** Footage **From** Exterior Section Lines:Change of **Top of Productive Zone** Footage **To** Exterior Section Lines:Current **Top of Productive Zone** Location **From** Sec _____New **Top of Productive Zone** Location **To** Sec _____Change of **Bottomhole** Footage **From** Exterior Section Lines:Change of **Bottomhole** Footage **To** Exterior Section Lines:Current **Bottomhole** Location Sec _____ Twp _____New **Bottomhole** Location Sec _____ Twp _____

Is location in High Density Area? _____

Distance, in feet, to nearest building _____, public road: _____, above ground utility: _____, railroad: _____,
property line: _____, lease line: _____, well in same formation: _____

Ground Elevation _____ feet Surface owner consultation date _____

FNL/FSL		FEL/FWL	
1982	FSL	736	FWL
Twp 1N	Range 67W	Meridian 6	
Twp	Range	Meridian	
			**
Twp	Range		
Twp	Range		
			**
			** attach deviated drilling plan

CHANGE OR ADD OBJECTIVE FORMATION AND/OR SPACING UNIT

<u>Objective Formation</u>	<u>Formation Code</u>	<u>Spacing Order Number</u>	<u>Unit Acreage</u>	<u>Unit Configuration</u>

OTHER CHANGES

☐ **REMOVE FROM SURFACE BOND** Signed surface use agreement is a required attachment

☐ **CHANGE OF WELL, FACILITY OR OIL & GAS LOCATION NAME OR NUMBER**

From: Name STIEBER Number 12-24A Effective Date: _____

To: Name _____ Number _____

☐ **ABANDON PERMIT: Permit can only be abandoned if the permitted operation has NOT been conducted. Field inspection will be conducted to verify site status.**

☐ WELL: Abandon Application for Permit-to-Drill (Form2) – Well API Number _____ has not been drilled.

☐ PIT: Abandon Earthen Pit Permit (Form 15) – COGCC Pit Facility ID Number _____ has not been constructed (Permitted and constructed pit requires closure per Rule 905)

☐ CENTRALIZED E&P WASTE MANAGEMENT FACILITY: Abandon Centralized E&P Waste Management Facility Permit (Form 28) – Facility ID Number _____ has not been constructed (Constructed facility requires closure per Rule 908)

OIL & GAS LOCATION ID Number: _____

☐ Abandon Oil & Gas Location Assessment (Form 2A) – Location has not been constructed and site will not be used in the future.

☐ Keep Oil & Gas Location Assessment (Form 2A) active until expiration date. This site will be used in the future.

Surface disturbance from Oil and Gas Operations must be reclaimed per Rule 1003 and Rule 1004.

☐ **REQUEST FOR CONFIDENTIAL STATUS**

☐ **DIGITAL WELL LOG UPLOAD**

☐ **DOCUMENTS SUBMITTED** Purpose of Submission: _____

RECLAMATION**INTERIM RECLAMATION**

☐ Interim Reclamation will commence approximately _____

Per Rule 1003.e.(3) operator shall submit Sundry Notice reporting interim reclamation is complete and site is ready for inspection when vegetation reaches 80% coverage.

☐ Interim reclamation complete, site ready for inspection.

Per Rule 1003.e(3) describe interim reclamation procedure in Comments below or provide as an attachment and attach required location photographs.

Field inspection will be conducted to document Rule 1003.e. compliance

FINAL RECLAMATION

☐ Final Reclamation will commence approximately _____

Per Rule 1004.c.(4) operator shall submit Sundry Notice reporting final reclamation is complete and site is ready for inspection when vegetation reaches 80% coverage.

☐ Final reclamation complete, site ready for inspection. Per Rule 1004.c(4) describe final reclamation procedure in Comments below or provide as an attachment.

Field inspection will be conducted to document Rule 1004.c. compliance

Comments:

ENGINEERING AND ENVIRONMENTAL WORK

☐ NOTICE OF CONTINUED TEMPORARILY ABANDONED STATUS

Indicate why the well is temporarily abandoned and describe future plans for utilization in the COMMENTS box below or provide as an attachment, as required by Rule 319.b.(3).

Date well temporarily abandoned _____ Has Production Equipment been removed from site? _____

Mechanical Integrity Test (MIT) required if shut in longer than 2 years. Date of last MIT _____

☐ SPUD DATE: _____

TECHNICAL ENGINEERING AND ENVIRONMENTAL WORK

Details of work must be described in full in the COMMENTS below or provided as an attachment.

☒ NOTICE OF INTENT Approximate Start Date 03/30/2015

☐ REPORT OF WORK DONE Date Work Completed _____

- | | | |
|--|---|--|
| <input type="checkbox"/> Intent to Recomplete (Form 2 also required) | <input type="checkbox"/> Request to Vent or Flare | <input type="checkbox"/> E&P Waste Management Plan |
| <input type="checkbox"/> Change Drilling Plan | <input checked="" type="checkbox"/> Repair Well | <input type="checkbox"/> Beneficial Reuse of E&P Waste |
| <input type="checkbox"/> Gross Interval Change | <input type="checkbox"/> Rule 502 variance requested. Must provide detailed info regarding request. | |
| <input type="checkbox"/> Other _____ | <input type="checkbox"/> Status Update/Change of Remediation Plans for Spills and Releases | |

COMMENTS:

1 Well needs Fox Hills remedial cement coverage due to water wells within one mile ahead of the Fort Lupton Campaign.
2 Gyro ran 2/27/2014, do not run another gyro.
3 Call Foreman or Lead Operator at least 24 hrs prior to rig move. If not already completed, request that they catch and remove plunger, isolate production equipment and remove any automation equipment prior to the rig showing up. Install perimeter fence as needed.
4 MIRU slickline. Fish plunger from lubricator. RIH and pull the bumper spring and standing valve if necessary. RIH with sinker bars and tag bottom (last cleaned out to ~8115' 9/2009). Report findings. RDMO slickline.
5 Prepare location for base beam rig.
6 Spot a minimum of 30 jts of 2-3/8", 4.7#, J-55, EUE tbg for replacement and 60 jts 1.66", 2.33#/ft, J-55, 10rd IJ for annular cement job.
7 MIRU WO rig and auxiliary equipment. Kill well with fresh water and biocide. ND tree and adapter flange, NU BOP's.
8 Unland 2-3/8" tbg and lay down landing joint.
9 MIRU EMI services. EMI 2-3/8" tbg while TOO H and tally while standing back, do not exceed safety tensile load of 53,000 lbs. Lay down joints that have greater than 35% penetration or wall loss. Clearly mark and replace all joints that fail EMI testing as red band. Document joint numbers and depth of bad tubing and create a Production Equipment Failure report in OpenWells. RDMO EMI services.
10 MIRU wireline. RIH with gauge ring (4-1/2", 11.6#) to 8000' and POOH. RIH on wireline with CCL and 4-1/2" 10,000 psi rated from above and below RBP. Set RBP @ +/- 7820', (collars at 7797' and 7839') and POOH. Dump bail 2 sx of sand on top of RBP. Pressure test RBP and casing to 5000 psi for 15 minutes.
11 Bleed off pressure. ND BOP's, ND wellhead, Un-land 4 1/2" casing, NU dual entry flange, NU BOP.
12 PU 1.66" 2.33#/ft J-55 10rd IJ tubing, and TIH outside 4-1/2" casing in open hole to ~1800', if unable to make depth, contact engineering to discuss plan moving forward. Circulate with the rig pump while TIH to clean up the annulus. Use two sweeps of Alcomer 74L while TIH and a final sweep at 1800'. Make sure no pressure is present on bradenhead before moving on to the next step. If gas is detected, contact engineering to discuss plan moving forward.
13 Contact Imperial mud (min of 24hrs. in advance) to bring out 20bbbls of 10.0ppg mud. Pump 20bbbls of mud at 1800'. Leave 1.66" tbg full of mud to avoid wet trip and PUH to 1600' to place cement in annulus.
14 MIRU cement services. Mix & pump as follows: 10 bbbls fresh water followed by 220 sx of Type III with 1/4 lb/sk cello-flake mixed at 14.8 ppg and 1.33 cuft/sk blended for a 3 hr pump time. Design is for coverage from 1,600' to 790' in 8.5" Borehole (has caliper log over SX interval) with 40% excess.
15 TOO H ~35 joints to ~500' and circulate 1.5 times the hole volume of water treated with biocide or until no cement returns are seen. TOO H with 1.66" tubing.
16 RDMO cementing company.
17 ND BOP. ND dual entry flange and crossover. Pick up and land 4-1/2" casing in slips.
18 Install new GE 5000 psi 4-1/2" bottom threaded tbg head with 7-1/16" flanged top, 7-1/16" flanged 5000 psi tbg head adaptor with 2 -1/16" studded top, 2-1/16" flanged 5000 psi master valve, flanged 5000 psi 2-3/8" plunger lubricator (side outlets threaded). All valves, fittings, plugs on well head need to be rated for 5000 psi. NU BOP.
19 Leave well shut in for ~24hrs.
20 MIRU wireline and run CCL-GR-CBL-VDL from 2000' to surface. If new top of cement is below 792' notify Engineering. In addition to normal handling of logs/job summaries, email copies of all cement job logs/job summaries and invoices to rscDJVendors@anadarko.com within 24 hours of the completion of the job.
21 RDMO wireline.
22 PU and TIH with 2-3/8" tbg and retrieving head. Circulate sand off RBP at @ +/-7820'. TOO H with RBP and SB tbg.

CASING AND CEMENTING CHANGES

Casing Type	Size	Of	/	Hole	Size	Of	/	Casing	Wt/Ft	Csg/LinTop	Setting Depth	Sacks of Cement	Cement Bottom	Cement Top

H2S REPORTING

Data Fields in this section are intended to document Sample and Location Data associated with the collection of a Gas Sample that is submitted for Laboratory Analysis.

Gas Analysis Report must be attached.

H2S Concentration: _____ in ppm (parts per million)

Date of Measurement or Sample Collection _____

Description of Sample Point:

Absolute Open Flow Potential _____ in CFPD (cubic feet per day)

Description of Release Potential and Duration (If flow is not open to the atmosphere, identify the duration in which the container or pipeline would likely be opened for servicing operations.):

Distance to nearest occupied residence, school, church, park, school bus stop, place of business, or other areas where the public could reasonably be expected to frequent: _____

Distance to nearest Federal, State, County, or municipal road or highway owned and principally maintained for public use: _____

COMMENTS:

Best Management Practices

No BMP/COA Type

Description

--	--

Operator Comments:

23 TIH with 2-3/8" NC, 2-3/8" XN SN and 2-3/8" 4.7# J55 EUE tbg, circulate out fill if necessary to 8150'. Land tbg @ +/- 8020' (1 jt above top JS perf).
24 Broach tubing to seating nipple. ND BOP's, NU master valve and tubing head adaptor.
25 GE should pressure test tbg head through test port on side of tbg head adaptor flange to 5000 psi for 15 mins.
26 RDMO WO rig.
27 Clean location and swab well back to production. Notify Field Foreman/Field Coordinator of finished work and turn well back over to production team.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Cheryl Light _____
Title: Sr. Regulatory Analyst _____ Email: DJRegulatory@anadarko.com _____ Date: _____

Based on the information provided herein, this Sundry Notice (Form 4) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY:**General Comments**

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
-------------------	----------------	---------------------

--	--	--

Total: 0 comment(s)

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
--------------------	-------------

400809378	OTHER
-----------	-------

Total Attach: 1 Files