

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400813121

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name: Rains, Bill

Tel: (970) 590-6480

COGCC contact:

Email: bill.rains@state.co.us

API Number 05-123-20876-00

Well Name: STATE 6524

Well Number: 11-28

Location: QtrQtr: NWNW Section: 28 Township: 6N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.462500

Longitude: -104.449140

GPS Data:

Date of Measurement: 07/02/2007

PDOP Reading: 2.2

GPS Instrument Operator's Name: Holly L. Tracy

Reason for Abandonment:

☐ Dry☒ Production for Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☒ Yes☐ No

Estimated Depth: 2850

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

| Formation | Perf. Top | Perf. Btm | Abandoned Date | Method of Isolation | Plug Depth |
|-----------|-----------|-----------|----------------|---------------------|------------|
| CODELL | 6780 | 6788 | | | |

Total: 1 zone(s)

Casing History

| Casing Type | Size of Hole | Size of Casing | Weight Per Foot | Setting Depth | Sacks Cement | Cement Bot | Cement Top | Status |
|-------------|--------------|----------------|-----------------|---------------|--------------|------------|------------|--------|
| SURF | 12+1/4 | 8+5/8 | 24 | 366 | 200 | 366 | 0 | |
| 1ST | 7+7/8 | 4+1/2 | 10.5 | 6,956 | 400 | 6,956 | 2,956 | |

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6730 with 20 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 110 sks cmt from 6500 ft. to 4900 ft. Plug Type: CASING Plug Tagged: ☒

Set 50 sks cmt from 2750 ft. to 3050 ft. Plug Type: STUB PLUG Plug Tagged: ☒

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 200 sacks half in. half out surface casing from 600 ft. to 0 ft. Plug Tagged: ☒

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure

Codell

Existing Perforations:

Codell: 6780'-6788'

PBTD: 6956'

8 5/8" 24# @ 366' w/ 200 sks cmt

4 1/2" 10.5# @ 6956' w/ 400 sks cmt (TOC @ 2956')

Procedure:

1. MIRU wireline

2. RIH set CIBP @ 6730'

3. RIH w/dump bailer and dump 20 sx cement on top of CIBP @ 6730' to cover 50' above Niobrara (6495'-6730')

4. TOH set 110 sk balance plug @ Parkman/Sussex (3500'-4900')

5. RIH w/ casing cutter, cut @ 2850'

6. TIH set 50 sk stub plug (2750'-3050')

7. TOH and set 200 sack cement plug half in half out of surface casing from 600' to surface

8. Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen

Title: Regulatory TEch Date: _____ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

Attachment Check List

Att Doc Num

Name

| | |
|-----------|------------------|
| 400813140 | WELLBORE DIAGRAM |
| 400813142 | WELLBORE DIAGRAM |

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

| | | |
|--|--|--|
| | | |
|--|--|--|

Total: 0 comment(s)