

FORM
6
Rev
12/05

State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
----	----	----	----

Replug By Other Operator

Document Number:

400796265

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 100322 Contact Name: Hunter Dunham
 Name of Operator: NOBLE ENERGY INC Phone: (303) 228-4308
 Address: 1625 BROADWAY STE 2200 Fax: (303) 228-4286
 City: DENVER State: CO Zip: 80202 Email: hdunham@nobleenergyinc.com

For "Intent" 24 hour notice required, Name: Gomez, Jason Tel: (970) 573-1277
COGCC contact: Email: jason.gomez@state.co.us

API Number 05-123-05679-00
 Well Name: Bradbury Well Number: 1
 Location: QtrQtr: NENW Section: 15 Township: 9N Range: 58W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WILDCAT Field Number: 99999

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.749790 Longitude: -103.847460
 GPS Data:
 Date of Measurement: 11/21/2013 PDOP Reading: 1.8 GPS Instrument Operator's Name: Brian Rottinghaus
 Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
LYONS	7436		02/22/2014	CEMENT	1528

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	13+1/2	10+3/4	32.75	300	300	300	0	VISU

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 252 sks cmt from 1528 ft. to 0 ft. Plug Type: OPEN HOLE Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:
Set _____ sacks at surface
Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: 02/22/2014
*Wireline Contractor: _____ *Cementing Contractor: BISON OIL WELL CEMENTING
Type of Cement and Additives Used: _____
Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

PROCEDURE:

- 1) Survey and locate abandoned well, mark with stake
- 2) Excavate to expose top of surface casing
- 3) Weld 2" collar to top of 10 3/4" surface casing cap. Make up to collar, pneumatic drill with non-sparking bit. Drill out cap venting possible trapped gas.
- 4) Once verified that no gas exists beneath top of surface casing plate, cut off surface casing below plate with torch, dress up smooth.
- 5) Butt weld 10 3/4" casing to dressed cut, bringing threaded end of casing to ground level.
- 6) Make up to 10 3/4" casing, one 10 3/4" collar and 10 3/4" starter well head
- 7) NU flange adaptor and 5k BOP, test BOP.
- 8) NU and RIH with 6 7/8" cone bit, PU 2 7/8" drill collar, 2 7/8" 8.7# tubing, and TIW valve
- 9) Drill out first cement plug inside surface casing, roll hole clean. Verify top of next cement plug inside of surface casing by tagging.
- 10) If unable to verify isolation of surface casing with tag of cement plug, set RBP inside surface casing
- 11) Once isolation of surface casing is established, either with tagging of cement plug or setting of RBP, pressure test surface casing to 200psi
- 12) After pressure test of surface casing, retrieve RBP or continue drill out of cement plug under surface casing shoe.
- 13) Assume pressure under surface casing shoe, roll hole with kill fluid until well dead, or blow down.
- 14) Continue RIH, cleaning out with drilling mud or water to 3000'
- 15) TOO H with cone bit, drill collars, and 2 7/8" tubing.
- 16) PU and RIH with mule shoe and 2 7/8" tubing to 3000'.
- 17) RU cement crew and pump a balanced plug of 100sk 15.8 ppg Class G "neat" cement
- 18) POOH to 1150' (150' below deepest water well @ 1000')
- 19) RU cement crew and pump 498 sxs of 15.8ppg Class G "neat" cement bring cement to surface
- 20) POOH with 2 7/8" tubing. Wait 4 hrs, and tag TOC. If cement has fallen, top off back to surface
- 21) Let cement set over night, verify cement has not settled and is still at surface. RDMO
- 22) Excavate around wellhead to 8' below grade, cut off 10 3/4" casing, weld on cap
- 23) Backfill hole and reclaim surface to original conditions

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Eileen Roberts
Title: Regulatory Analyst I Date: _____ Email: eroberts@nobleenergyinc.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
400796303	WELLBORE DIAGRAM
400796315	CEMENT JOB SUMMARY
400815643	PROPOSED PLUGGING PROCEDURE
400815645	WELLBORE DIAGRAM

Total Attach: 4 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)