

Document Number:  
400820425

Date Received:

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen  
 Name of Operator: PDC ENERGY INC Phone: (303) 8605800  
 Address: 1775 SHERMAN STREET - STE 3000 Fax: \_\_\_\_\_  
 City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

**For "Intent" 24 hour notice required,** Name: Montoya, John Tel: (970) 397-4124  
**COGCC contact:** Email: john.montoya@state.co.us

API Number 05-123-13838-00 Well Number: 5-5  
 Well Name: BECKER  
 Location: QtrQtr: SESE Section: 5 Township: 3N Range: 64W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: 61748  
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon       Subsequent Report of Abandonment

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.249280 Longitude: -104.568426  
 GPS Data:  
 Date of Measurement: 12/20/2009 PDOP Reading: 2.3 GPS Instrument Operator's Name: Brandon Lucason  
 Reason for Abandonment:  Dry  Production for Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Estimated Depth: 3985  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6924	6930			
NIOBRARA	6661	6811			
SUSSEX	4280	4306			

Total: 3 zone(s)

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	538	440	538	0	
1ST	7+7/8	3+1/2	9.3	7,075	830	7,075	4,035	

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6610 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #3: Depth 4230 with 2 sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 3835 ft. to 4085 ft. Plug Type: STUB PLUG Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)

Set 200 sacks half in. half out surface casing from 600 ft. to 0 ft. Plug Tagged:   
 Set \_\_\_\_\_ sacks at surface  
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
 Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
 \*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
 Type of Cement and Additives Used: \_\_\_\_\_  
 Flowline/Pipeline has been abandoned per Rule 1103  Yes  No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure  
 Sussex/Niobrara/Codell  
 Existing Perforations:  
 Sussex: 4280'-4306'  
 Niobrara: 6661'-6811'  
 Codell: 6924'-6930'  
 PBTD: 7043'  
 8 5/8" 24# @ 538' w/ 440 sks cmt  
 3 1/2" 9.3# @ 7075' w/ 830 sks cmt (TOC @ 4035')  
 Procedure:  
 1. MIRU wireline  
 2. RIH set CIBP @ 6610'  
 3. RIH w/dump bailer and dump 2 sk cement on top of CIBP @ 6610'  
 4. RIH set CIBP @ 4230'  
 5. RIH w/dump bailer and dump 2 sk cement on top of CIBP @ 4230'  
 6. RIH w/ casing cutter, cut @ 3985'  
 7. TIH set 50 sk stub plug (3835'-4085')  
 8. TOH and set 200 sack cement plug half in half out of surface casing from 600' to surface  
 9. Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Jenifer Hakkarinen  
 Title: Regulatory Tech Date: \_\_\_\_\_ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

### Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
400820425	FORM 6 INTENT SUBMITTED
400820431	WELLBORE DIAGRAM
400820432	WELLBORE DIAGRAM

Total Attach: 3 Files

### General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)