

Document Number:
400864019

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen
 Name of Operator: PDC ENERGY INC Phone: (303) 8605800
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required, Name: Rickard, Jeff Tel: (720) 305-8280
 COGCC contact: Email: jeffrey.rickard@state.co.us

API Number 05-123-13319-00 Well Number: 10-2
 Well Name: OSTER
 Location: QtrQtr: NESE Section: 10 Township: 4N Range: 67W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: 68349
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.324970 Longitude: -104.869310
 GPS Data:
 Date of Measurement: 04/02/2008 PDOP Reading: 2.1 GPS Instrument Operator's Name: Holly L. Tracy
 Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 5720
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA-CODELL	6881	7214			

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	310	215	310	0	
1ST	7+7/8	2+7/8	6.5	7,302	450	7,302	5,770	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6830 with 1 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set <u>50</u> sks cmt from <u>5570</u> ft. to <u>5770</u> ft.	Plug Type: <u>STUB PLUG</u>	Plug Tagged: <input checked="" type="checkbox"/>
Set <u>340</u> sks cmt from <u>3500</u> ft. to <u>4650</u> ft.	Plug Type: <u>OPEN HOLE</u>	Plug Tagged: <input checked="" type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>
Set _____ sks cmt from _____ ft. to _____ ft.	Plug Type: _____	Plug Tagged: <input type="checkbox"/>

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set 200 sacks half in. half out surface casing from 600 ft. to 0 ft. Plug Tagged:
 Set _____ sacks at surface
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No
 Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____
 *Wireline Contractor: _____ *Cementing Contractor: _____
 Type of Cement and Additives Used: _____
 Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure
 Niobara/Codell
 Existing Perforations:
 Niobrara/Codell: 6881'-7214'
 PBTD: 7260'
 8 5/8" 24# @ 310' w/ 215 sks cmt
 2 7/8" 6.5# @ 7302' w/ 450 sks cmt (TOC @ 5770')
 Procedure:
 1. MIRU wireline
 2. RIH set CIBP @ 6830'
 3. RIH w/dump bailer and dump 1 sk cement on top of CIBP @ 6830'
 4. RIH w/ casing cutter, cut casing @ 5720'
 5. TIH set 50 sk stub plug @ casing stub (5570'-5770')
 6. TOH and set 340 sack plug to cover the Parkman/Sussex (3500'-4650')
 7. TOH and set 200 sack cement plug half in half out of surface casing from 600' to surface
 8. Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen
 Title: Regulatory Tech Date: _____ Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

Attachment Check List

Att Doc Num	Name
400864039	WELLBORE DIAGRAM
400864041	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group	Comment	Comment Date

Total: 0 comment(s)