

South Shale Ridge 16-16

COC 12735

SESE Section 16 T8S R98W 6 PM Mesa County

API # 05-077-08605

Plugging Procedure

1. MIRU. SU. Install BOPE.
2. Set a CIBP at 3450' and spot 2 sacks cement on top of plug.
3. Perforate 4½" production casing 1120' with 4 spf.
4. Set a CICR at 1020' and establish injection rate and pressure.
5. Mix and pump 30 sacks of 15.8 ppg Class G cement. Displace cement to retainer.
6. POOH laying down tubing.
7. Perforate 4½" casing at 143' with 4 spf.
8. Mix and pump down 4½" casing sufficient volume (42 sacks estimated) of 15.8 ppg Class G cement to circulate cement out 8⅝" surface casing valve. Shut down when good cement returns are observed at surface. Leave 4½" casing full of cement.
9. Excavate around wellhead to 6' below grade. Cut off casing strings 4' below grade.
10. Weld steel plate with weep hole on casing stub with the following information:

Maralex Resources, Inc.
COC12735
South Shale Ridge 16-16
SESE 16 8S 98W