

**Attachment to Form 6**

**Diamond Operating, Inc.**

**UPRR Work #1 [API #: 05-075-08156]**

**SW SW Section 23-T12N-R53W**

**Logan County, CO**

**Technical Details -- P & A Procedure ----- REVISED**

- 1) Rig up Yetter Well Service and POOH with rods and pump; release tubing anchor and circulate the hole with gel to prevent cement plugs from slipping; POOH with tubing.
- 2) RU wireline equipment; RIH with CIBP and set at 5280'; set 2 sacks of cement on top with dump bailer.
- 3) RIH with perforating gun and perforate one foot (4 shots) at 1500' and one foot (4 shots) at 700'; POOH with perforating equipment.
- 4) RIH with packer and tubing and set packer at 1380'; squeeze cement (40 sacks) through perfs at 1500' -- leave a minimum of 100' of cement inside casing; release packer and POOH with tubing to 580' and reset packer; squeeze cement (40 sacks) through perfs at 700' -- leaving a minimum of 100' of cement inside casing; POOH with tubing.
- 5) RIH with wireline equipment and cut casing at 140'; POOH with casing.
- 6) RIH with tubing and pump a cement plug from 140' to surface.
- 7) Cut off casing 4' below ground level and weld a steel plate on top.