

FORM  
6Rev  
12/05

# State of Colorado Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number:  400939957			
Date Received:			

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175	Contact Name: Kelsi Welch
Name of Operator: PDC ENERGY INC	Phone: (303) 831-3974
Address: 1775 SHERMAN STREET - STE 3000	Fax:
City: DENVER State: CO Zip: 80203	Email: kelsi.welch@pdce.com
For "Intent" 24 hour notice required, Name: Rickard, Jeff Tel: (720) 305-8280	
COGCC contact: Email: jeffrey.rickard@state.co.us	

API Number: 05-123-12714-00	Well Number: 2
Well Name: MCLEOD	
Location: QtrQtr: SESE Section: 29 Township: 4N Range: 66W Meridian: 6	
County: WELD	Federal, Indian or State Lease Number: 68136
Field Name: WATTENBERG	Field Number: 90750

☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

### Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.277222	Longitude: -104.793611
GPS Data:	
Date of Measurement: 06/02/2010	PDOP Reading: 1.6
GPS Instrument Operator's Name: Shantell Kling	
Reason for Abandonment: <input type="checkbox"/> Dry <input checked="" type="checkbox"/> Production for Sub-economic <input type="checkbox"/> Mechanical Problems	
<input type="checkbox"/> Other	
Casing to be pulled: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	Estimated Depth:
Fish in Hole: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Details:	

### Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7274	7297			
NIOBRARA	6971	7164			
Total: 2 zone(s)					

### Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	328	250	328	0	
1ST	7	4+1/2	11.6	7,400	200	7,400	6,446	

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6930 with 2 sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 50 sks cmt from 6263 ft. to 6450 ft. Plug Type: STUB PLUG Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 200 sacks half in. half out surface casing from 550 ft. to 0 ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

McLeod #2 (05-123-12714)/Plugging Procedure (Intent)  
Producing Formation: Niobrara - Codell  
Existing Perforations: Niobrara 6971'-7164' Codell 7274'-7297'  
TD: 7400' PBD: 7349'  
Surface Casing: 8 5/8" 24# @ 328' w/ 250 sks cmt.  
Production Casing: 4 1/2" 11.6# @ 7400' w/ 200 sks cmt (TOC 6446').

Tubing: 2" tubing set at 6945'

Proposed Procedure:

1. MIRU pulling unit. TOOH with 2 3/8" tubing.
2. Rig up wireline company. TIH with CIBP. Set CIBP at 6930'. TIH with dump bailer. Spot 2 sxs of 15.8#/gal CI G cement on top of CIBP.
3. TIH with casing cutter. Cut off 4 1/2" casing at 6400'. Pull 4 1/2" casing.
4. TIH with tubing to 6450'. RU cementers. Mix and pump 50 sxs of 15.8#/gal CI G cement.
5. Reset tubing at 550'. Mix and pump 200 sxs of 15.8#/gal CI G cement. Cement should circulate to surface.
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Kelsi Welch

Title: Regulatory Analyst Date: \_\_\_\_\_ Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_

Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**COA Type**

**Description**

--	--

**Attachment Check List**

**Att Doc Num**

**Name**

400939977	WELLBORE DIAGRAM
400939979	WELLBORE DIAGRAM

Total Attach: 2 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

--	--	--

Total: 0 comment(s)