

Document Number:
400954942

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Kelsi Welch
 Name of Operator: PDC ENERGY INC Phone: (303) 831-3974
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: kelsi.welch@pdce.com

For "Intent" 24 hour notice required, Name: Rickard, Jeff Tel: (720) 305-8280
 COGCC contact: Email: jeffrey.rickard@state.co.us

API Number 05-123-12362-00 Well Number: 2
 Well Name: MEINING
 Location: QtrQtr: NWNE Section: 30 Township: 4N Range: 66W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: 68909
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.287778 Longitude: -104.818056
 GPS Data:
 Date of Measurement: 06/21/2010 PDOP Reading: 2.7 GPS Instrument Operator's Name: Shantell Kling
 Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 6
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
NIOBRARA	6982	7272			
Total: 1 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	327	320	327	0	
1ST	7+7/8	4+1/2	11.6	7,383	275	7,383	6,332	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6932 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 500 ft. with 165 sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Meining #2 (05-123-12362)/Plugging Procedure (Intent)
Producing formation: Niobrara/Codell
Existing Perforations: Niobrara/Codell - 6,982'-7,272'
TD: 7,383' PBTD: 7,318'
Surface Casing: 8 5/8" 24# @ 327' w/ 320 sks cmt.
Production Casing: 4 1/2" 11.6# @ 7383' w/ 275 sks cmt (TOC at 6,332').
Proposed Procedure:
1. MIRU pulling unit.
2. Confirm well is dead.
3. Rig up wireline. RIH with perforating guns and shoot 4 holes for cement squeeze at 500'.
4. RU cementers. Mix and bullhead 165 sks of 15.8#/gal CL G cement down production casing and back up annular to provide 500 ft plug. Cement should circulate to surface on backside of production casing.
5. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Kelsi Welch

Title: Regulatory Analyst Date: _____ Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____ Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____ Expiration Date: _____

<u>COA Type</u>	<u>Description</u>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
400954980	WELLBORE DIAGRAM
400954983	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>

Total: 0 comment(s)