

FORM  
6Rev  
12/05State of Colorado  
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

400999849

Date Received:

## WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 10110

Contact Name: Ty Woodworth

Name of Operator: GREAT WESTERN OPERATING COMPANY LLC

Phone: (970) 274-9254

Address: 1801 BROADWAY #500

Fax:

City: DENVER State: CO Zip: 80202

Email: twoodworth@gwogco.com

For "Intent" 24 hour notice required,

Name: Montoya, John

Tel: (970) 397-4124

COGCC contact:

Email: john.montoya@state.co.us

API Number 05-001-06793-00

Well Name: UPRR-MEYER

Well Number: 1

Location: QtrQtr: SWSE Section: 9 Township: 2S Range: 63W Meridian: 6

County: ADAMS

Federal, Indian or State Lease Number:

Field Name: CHIEFTAIN

Field Number: 11060

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

## Only Complete the Following Background Information for Intent to Abandon

Latitude: 39.884892

Longitude: -104.438772

GPS Data:

Date of Measurement: 07/27/2012

PDOP Reading: 2.9

GPS Instrument Operator's Name: D. Schwartz

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☐ Yes☒ No

Estimated Depth:

Fish in Hole:

☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

## Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7531	7590	03/30/1974	B PLUG CEMENT TOP	7568

Total: 1 zone(s)

## Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	212	200	212	0	
1ST	7+7/8	4+1/2	11.6	7,664	250	7,664		

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7500 with \_\_\_\_\_ sacks cmt on top. CIBP #2: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #3: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 20 sks cmt from 6556 ft. to 6806 ft. Plug Type: CASING Plug Tagged: ☐  
Set 23 sks cmt from 300 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐  
Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged: ☐

Perforate and squeeze at 1300 ft. with 350 sacks. Leave at least 100 ft. in casing 1200 CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth

(Cast Iron Cement Retainer Depth)

Set \_\_\_\_\_ sacks half in. half out surface casing from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Tagged: ☐

Set \_\_\_\_\_ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_

\*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_

Type of Cement and Additives Used: \_\_\_\_\_

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

While going through the wellfile it appears a CIBP and 12 ft cement was set at 7568' over the bottom set of J Sand perms from 7573-7590 on 3/30/1974 (see attached well completion report). This leaves the J Sand perms from 7531-7543 still open. I wasnt sure hwo to report that on the "Zones" tab since it only allows one row per formation.

Proposal:

Set CIBP w/ 2 sx at 7475'.

(There is no CBL on file so we will run a CBL to verify TOC. If there is not 200 ft above top of Nio (6681 ft) we will perf and sqz thru a CICR leaving 100 ft below CICR. This may enable us to place the CICR above top of Nio and forego the balanced plug across Nio inside the 4 1/2". Hopefully I explained this alright - if there are questions please call)

Spot 20 sx balanced plug across top Nio from 6556 - 6806'.

Perf at 1300' and circ 350 sx cement to surface thru CICR at 1200' (Fox Hills base at 1243'). Leave 1/2 bbl cem on CICR. Pull up to 300' (88' below shoe) and fill 4 1/2" to surface with approx. 23 sx. Cut wellhead 4 ft down, weld on marker plate.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: Ty Woodworth

Title: Prod Eng Lead Date: \_\_\_\_\_ Email: twoodworth@gwogco.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: \_\_\_\_\_ Date: \_\_\_\_\_

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_

Expiration Date: \_\_\_\_\_

**COA Type**

**Description**

--	--

**Attachment Check List**

**Att Doc Num**

**Name**

401001389	WELLBORE DIAGRAM
401001390	WELLBORE DIAGRAM
401001391	OTHER
401001392	OTHER
401001393	OPERATIONS SUMMARY

Total Attach: 5 Files

**General Comments**

**User Group**

**Comment**

**Comment Date**

--	--	--

Total: 0 comment(s)