

Replug By Other Operator

Document Number:

400768639

Date Received:

01/12/2015

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.
 A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen
 Name of Operator: PDC ENERGY INC Phone: (303) 8605800
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required, Name: _____ Tel: _____
COGCC contact: Email: _____

API Number 05-123-11146-00 Well Number: 1
 Well Name: SMITH RANCHO
 Location: QtrQtr: NWNW Section: 1 Township: 6N Range: 66W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: 55709
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.522672 Longitude: -104.734060
 GPS Data:
 Date of Measurement: 12/29/2013 PDOP Reading: 2.2 GPS Instrument Operator's Name: Holly Tracy
 Reason for Abandonment: Dry Production for Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7314	7326	01/08/2014	CEMENT	

Total: 1 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	441	350	411	0	
1ST	7+7/8	4+1/2	11.6	7,490	250	7,490	0	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 135 sks cmt from 6113 ft. to 6571 ft. Plug Type: STUB PLUG Plug Tagged:
Set 223 sks cmt from 3459 ft. to 4216 ft. Plug Type: OPEN HOLE Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set 439 sacks half in. half out surface casing from 815 ft. to 0 ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Plugging Date: 01/08/2014

*Wireline Contractor: _____

*Cementing Contractor: Baker Hughes

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No

*ATTACH JOB SUMMARY

Technical Detail/Comments:

Plugging Procedure
Codell
Existing Perforations:
Codell: 7314'-7326'
PBTD: 7490'
8 5/8" 24# @ 441' W/ 350 sks cmt.
4 1/2" 11.6# @ 7490' w/ 250 sks cmt
Procedure:
1)MIRU Excavation crew
2)Locate and dig up old wellhead
3)Cut old casing and weld new casing stub to bring to surface, fill in hole
4)MIRU workover rig
5)RIH w/ bit, tag and drill through surface plug
6)RIH to tag stub plug @ 6588'
7)Set 135 sack cement plug @ 6571' (6113'-6571')
8)TOH to set 223 sack plug @ Parkman/Sussex (3459'-4216')
9)TOH and set 439 sack surface plug (815' - surface)
10)Cut casing and weld on cap

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: JEnifer Hakkarinen

Title: Regulatory Tech

Date: 1/12/2015

Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved:

Date: 12/15/2015

CONDITIONS OF APPROVAL, IF ANY:

COA Type

Description

COA Type	Description

Attachment Check List

Att Doc Num

Name

400768639	FORM 6 SUBSEQUENT SUBMITTED
400768665	CEMENT JOB SUMMARY
400768666	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

User Group

Comment

Comment Date

Public Room	Document verification complete 12/14/15	12/14/2015 3:46:58 PM
Agency	requested wireline ticket for casing pull	12/8/2015 9:35:41 AM
Permit	Final reclamation inspection report located 10/10/97 doc 211499	3/4/2015 1:16:44 PM

Total: 3 comment(s)