



DE	ET	OE	ES
Document Number: 401131022			
Date Received: 10/14/2016			

**WELL ABANDONMENT REPORT**

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.  
 A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120 Contact Name: CHERYL LIGHT  
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (720) 929-6461  
 Address: P O BOX 173779 Fax: (720) 929-7461  
 City: DENVER State: CO Zip: 80217- Email: CHERYL.LIGHT@ANADARKO.COM

**For "Intent" 24 hour notice required,** Name: Helgeland, Gary Tel: (970) 216-5749  
**COGCC contact:** Email: gary.helgeland@state.co.us

API Number 05-123-22951-00 Well Number: 8-4  
 Well Name: WHISTON  
 Location: QtrQtr: SENE Section: 4 Township: 2N Range: 67W Meridian: 6  
 County: WELD Federal, Indian or State Lease Number: \_\_\_\_\_  
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon  Subsequent Report of Abandonment

*Only Complete the Following Background Information for Intent to Abandon*

Latitude: 40.168758 Longitude: -104.887467  
 GPS Data:  
 Date of Measurement: 10/21/2008 PDOP Reading: 2.9 GPS Instrument Operator's Name: Cody Mattson  
 Reason for Abandonment:  Dry  Production Sub-economic  Mechanical Problems  
 Other \_\_\_\_\_  
 Casing to be pulled:  Yes  No Estimated Depth: 1070  
 Fish in Hole:  Yes  No If yes, explain details below  
 Wellbore has Uncemented Casing leaks:  Yes  No If yes, explain details below  
 Details: \_\_\_\_\_

**Current and Previously Abandoned Zones**

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7450	7468			
J SAND	7890	7950			
Total: 2 zone(s)					

**Casing History**

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	766	540	766	0	VISU
1ST	7+7/8	4+1/2	11.6	8,037	760	8,037	4,029	CBL

## Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7800 with 2 sacks cmt on top. CIBP #2: Depth 7385 with 35 sacks cmt on top.  
 CIBP #3: Depth 80 with 25 sacks cmt on top. CIBP #4: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.  
 CIBP #5: Depth \_\_\_\_\_ with \_\_\_\_\_ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 35 sks cmt from 7385 ft. to 6780 ft. Plug Type: CASING Plug Tagged:   
 Set 70 sks cmt from 4960 ft. to 4100 ft. Plug Type: CASING Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:   
 Set \_\_\_\_\_ sks cmt from \_\_\_\_\_ ft. to \_\_\_\_\_ ft. Plug Type: \_\_\_\_\_ Plug Tagged:

Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
 Perforate and squeeze at \_\_\_\_\_ ft. with \_\_\_\_\_ sacks. Leave at least 100 ft. in casing \_\_\_\_\_ CICR Depth  
(Cast Iron Cement Retainer Depth)

Set 220 sacks half in. half out surface casing from 1170 ft. to 716 ft. Plug Tagged:   
 Set \_\_\_\_\_ sacks at surface  
 Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker:  Yes  No  
 Set \_\_\_\_\_ sacks in rat hole Set \_\_\_\_\_ sacks in mouse hole

### Additional Plugging Information for Subsequent Report Only

Casing Recovered: \_\_\_\_\_ ft. of \_\_\_\_\_ inch casing Plugging Date: \_\_\_\_\_  
 \*Wireline Contractor: \_\_\_\_\_ \*Cementing Contractor: \_\_\_\_\_  
 Type of Cement and Additives Used: \_\_\_\_\_  
 Flowline/Pipeline has been abandoned per Rule 1103  Yes  No \*ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: \_\_\_\_\_ Print Name: CHERYL LIGHT  
 Title: SR REGULATORY ANALYST Date: 10/14/2016 Email: DJREGULATORY@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: McCoy, Diane Date: 10/27/2016

**CONDITIONS OF APPROVAL, IF ANY:** \_\_\_\_\_ Expiration Date: 4/26/2017

COA Type	Description
	1) Prior to starting plugging operations, a bradenhead test shall be performed. If any pressure remains at the conclusion of the test or any liquids were present contact COGCC Engineer for sampling requirements. The Form 17 shall be submitted within 10 days of the test. 2) Provide 48 hour notice of plugging MIRU via electronic Form 42. 3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete. 4) Production casing stub plug is also surface casing shoe plug, this plug must be tagged at 716' or shallower. Leave at least 100' of cement in the wellbore for each plug.

## Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
401131022	FORM 6 INTENT SUBMITTED
401131024	PROPOSED PLUGGING PROCEDURE
401131025	WELLBORE DIAGRAM

Total Attach: 3 Files

## General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Public Room	Document verification complete 10/17/16	10/17/2016 3:13:31 PM

Total: 1 comment(s)