



Procedure:

1. MIRU WOR.
2. Blow well down. NO TBG, make sure there is no pressure before proceeding. Last blow down test was positive but pressure comes back within hours.
3. ND WH, NU BOP, test.
4. RU WL & TIH w/4-1/2" CIBP.
5. Set CIBP @ 1,680' and bail 2 sx cmt on top.
6. RDMO WL.
7. TIH w/SN & 2-3/8" TBG, land EOT @ 1,550'.
8. ND BOP, NU WH.
9. RDMO Service Unit, RTP.

Perfs

Shallow	Deep
1,554	1,597
1,606	1,618
1,660	1,680
1,699	1,702

CIBP setting depth +2 sx