

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Replug By Other Operator

Document Number:

401146020

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name:

Tel:

COGCC contact:

Email:

API Number 05-123-07340-00

Well Name: MOBLY-STATE

Well Number: 41-16

Location: QtrQtr: NENE Section: 16 Township: 7N Range: 66W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WILDCAT

Field Number: 99999

☐ Notice of Intent to Abandon☒ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.580683

Longitude: -104.775742

GPS Data:

Date of Measurement: 01/09/2015

PDOP Reading: 1.7

GPS Instrument Operator's Name: Jenifer Hakkarinen

Reason for Abandonment:

☐ Dry☐ Production Sub-economic☐ Mechanical Problems☐ Other

Casing to be pulled:

☐ Yes☐ No

Estimated Depth:

Fish in Hole:

☐ Yes☐ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☐ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation

Perf. Top

Perf. Btm

Abandoned Date

Method of Isolation

Plug Depth

Total: 0 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	231	200	231	0	
1ST	7+7/8	4+1/2	11.6	8,122	300	8,122	7,319	

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth _____ with _____ sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 171 sks cmt from 7033 ft. to 5690 ft. Plug Type: OPEN HOLE Plug Tagged: ☐
Set 170 sks cmt from 4595 ft. to 3368 ft. Plug Type: OPEN HOLE Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 220 sacks half in. half out surface casing from 626 ft. to 0 ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing

Plugging Date: 01/20/2015

*Wireline Contractor: _____

*Cementing Contractor: Ridge

Type of Cement and Additives Used: 15.8 ppg class G cement

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No

*ATTACH JOB SUMMARY

Technical Detail/Comments:

Mobly State 41-6
123-07340
R-entry plugging procedure
1) Locate well, cut cap
2) Drill out top plug down to the shoe
3) Run packer, pressure test surface casing
4) Condition hole
5) RIH tag stub at 7050 , pump 171 sack plug from 7033'-5690'
6) Pump 170 sack plug from 3368'-4595' to cover the Parkman/sussex
7) Pump 220 sack plug from 626' to surface
8) Cut 6' below surface and cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____

Print Name: Jenifer Hakkarinen

Title: Reg Tech

Date: _____

Email: Jenifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

<u>COA Type</u>	<u>Description</u>

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
401146349	GYRO SURVEY
401146350	WELLBORE DIAGRAM
401146353	CEMENT JOB SUMMARY

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
		Stamp Upon Approval

Total: 0 comment(s)