

Engineer: Savanna Riebe
Cell Phone Number: 970-714-0288

PLUG and ABANDONMENT PROCEDURE

HSR-PFAELZER 12-13A

Step Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline . Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was ran in May 2012. RDMO Slickline .
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Spot a min of 25 jts of 2-3/8" 4.7#, J-55, EUE tbg. Kill well as necessary using clean fresh water with biocide. ND WH. NU BOP. Unland tbg using unlanding joint and LD. Release packer set at 3833'.
7. TOO H and SB all 2-3/8" tbg. LD packer and all 1-1/4" tbg.
8. PU and TIH with (4.5", 11.6#) Bit and Scraper on 2-3/8" tbg to 7476' (Liner top). TOO H.
9. MIRU WL. PU and RIH with (4.5", 11.6#) CIBP and set at +/- 7470' (collars at 7042' & 7082'). POOH. RIH and dump 2 sx cement on CIBP. POOH.
10. PU and RIH with (4.5", 11.6#) CIBP and set at +/- 7060' (collars at 7042' & 7082'). POOH. RDMO WL.
11. TIH with 2-3/8" tbg to 7060' . Load hole with biocide treated fresh water and circulate all gas out of well. TOO H and SB 2-3/8" tbg.
12. MIRU hydrotesters. TIH with 2-3/8" tbg to 2500' while hydrotesting to 3000 psi. RDMO hydrotesters. PT CIBP to 1000psi for 15 minutes.
13. RIH and run CBL from 7470' to surface. Forward CBL to Platteville office. Cementing plans may change depending on CBL results.
14. MIRU Cementers. Pump Niobrara Balance Plug: Pump 25 sxs (39cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 400' inside 4.5", 11.6# production casing with no excess. Cement will be from 7060'-6660'. RD cementers.
15. Slowly pull out of the cement. LD tbg while TOO H to 4580'.
16. Establish circulation to surface with biocide treated fresh water.
17. RU Cementers. Pump Sussex Balance Plug: Pump 25 sx (39 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume is based on 405' inside 4.5", 11.6# production casing with no excess. Cement will be from 4580'-4175'. RD cementers.
18. Slowly pull out of the cement and TOO H to 3675'. Reverse circulate to ensure no cement is left in the tbg.
19. TOO H and SB 1385' of 2-3/8" tbg. LD remaining tbg.
20. MIRU WL. Tag cement as needed. RIH and jet cut 4.5", 11.6# casing at 1285'. RDMO WL.
21. Attempt to establish circulation and circulate 100 bbls with fresh water containing biocide to remove any gas.
22. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.
23. Install BOP on casing head with 4.5", 11.6# pipe rams.
24. TOO H and LD all 4.5", 11.6# casing. Remove 4.5", 11.6# pipe rams and install 2-3/8" pipe rams.

- 25.** TIH with mule shoe and 2-3/8" tubing to 1385'.
- 26.** Establish circulation with biocide treated fresh water and pump one hole volume 100 bbls.
- 27.**

RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump Stub Plug: 280 sxs (420 cf) with 0.25 lb/sk Polyflake, assuming 15.8 ppg & 1.50 cf/sk. Volume is based on 100' in 4.5", 11.6# production casing with no excess, 616' in 7.88" bit size w/ 60% excess factor, and 199' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 1385'-470'. RDMO cementers. Notify engineering if circulation is ever lost during job.
- 28.** Slowly pull out of the cement and TOO H to 100'. Reverse circulate using biocide treated fresh water, to ensure the tubing is clean. TOO H, LD all 2-3/8" tbg.
- 29.** MIRU WL. Tag cement as needed. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
- 30.** Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
- 31.** Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
- 32.** Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
- 33.** Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
- 34.** Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
- 35.** Welder cut casing minimum 5' below ground level.
- 36.** Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
- 37.** Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
- 38.** Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
- 39.** Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
- 40.** Back fill hole with fill. Clean location, and level.
- 41.** Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.