

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

12/16/2016

Submitted Date:

12/21/2016

Document Number:

682401626**FIELD INSPECTION FORM**

Loc ID 448414 Inspector Name: Binschus, Chris On-Site Inspection ☐ 2A Doc Num: _____

Operator Information:OGCC Operator Number: 100322Name of Operator: NOBLE ENERGY INCAddress: 1625 BROADWAY STE 2200City: DENVER State: CO Zip: 80202**Status Summary:**☐ THIS IS A FOLLOW UP INSPECTION☒ FOLLOW UP INSPECTION REQUIRED☐ NO FOLLOW UP INSPECTION REQUIRED**Findings:**4 Number of Comments2 Number of Corrective Actions☒ Corrective Action Response Requested**Contact Information:**

| Contact Name | Phone | Email | Comment |
|--------------|-------|--|---------|
| , | | NBL_DJBU_Inspections@NB LENERGY.COM | |

Inspected Facilities:

| Facility ID | Type | Status | Status Date | Well Class | API Num | Facility Name | Insp Status |
|-------------|----------|--------|-------------|------------|---------|----------------|-------------|
| 448414 | LOCATION | AC | 11/27/2016 | | - | Angus Facility | CI |

General Comment:

[This is a construction and stormwater inspection in response to Form 42 Document #401159024- Notice of construction of a new location.](#)

Location Construction

Location ID: 448414 CDP: _____

Comment: Topsoil was not salvaged per Rule 1002.b. on a 0.75 acre pad.

Corrective Action: Using the Field Inspection Report Resolution (FIRR) form, please indicate how topsoil will be protected per Rule 1002.b.

Date: 01/18/2017

Form 2A COAs:

Comment: _____

Corrective Action: _____

Date: _____

Wildlife BMPs:

Comment: _____

Corrective Action: _____

Date: _____

Stormwater:

| | | | |
|--------------|---------|------------|---------|
| Erosion BMPs | Present | Other BMPs | Present |
| | | | |

Comments: Erosion BMPs: No stormwater or erosion control BMPs in place prior to or during construction.

Other BMPs: _____

Corrective Action: Install sufficient BMPs in accordance with good engineering practices per Rule 1002.f. Refer to the 1002.f guidance document for further details. Date: 01/04/2017

7

Comment: _____

Corrective Action: _____

Date: _____

On Site Inspection (305):Surface Owner Contact Information:

Name: _____

Address: _____

Phone Number: _____

Cell Phone: _____

Operator Rep. Contact Information:

Landman Name: _____

Phone Number: _____

Date Onsite Request Received: _____

Date of Rule 306 Consultation: _____

Request LGD Attendance: _____

LGD Contact Information:

Name: _____ Phone Number: _____ Agreed to Attend: _____

Summary of Landowner Issues:

Summary of Operator Response to Landowner Issues:

Onsite Inspection Memorandum Summarizing Discussions at Inspection as Attachment:

Inspected FacilitiesFacility ID: 448414 Type: LOCATION API Number: - Status: AC Insp. Status: CI**COGCC Comments**

| Comment | User | Date |
|---|-----------|------------|
| Refer to attached inspection photos in Document #682401627. | binschusc | 12/21/2016 |

Attached DocumentsYou can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

| Document Num | Description | URL |
|--------------|-----------------|---|
| 682401627 | Location Photos | http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4034212 |