

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401229059

Date Received:

03/09/2017

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Kelsi Welch

Name of Operator: PDC ENERGY INC

Phone: (303) 831-3974

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: kelsi.welch@pdce.com

For "Intent" 24 hour notice required,

Name: Pesicka, Conor

Tel: (970) 415-0789

COGCC contact:

Email: conor.pesicka@state.co.us

API Number 05-123-20982-00

Well Name: WELLS RANCH

Well Number: 13-34

Location: QtrQtr: NWSW Section: 34 Township: 6N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.441170

Longitude: -104.430031

GPS Data:

Date of Measurement: 10/31/2006

PDOP Reading: 1.8

GPS Instrument Operator's Name: H.L. TRACY

Reason for Abandonment: ☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☐ Yes☒ No

Estimated Depth:

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks: ☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6770	6776			
NIOBRARA	6498	6610			

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	406	225	406	0	
1ST	7+7/8	4+1/2	10.5	6,956	615	6,956	322	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6448 with 2 sacks cmt on top. CIBP #2: Depth _____ with _____ sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 60 sks cmt from 650 ft. to 0 ft. Plug Type: CASING Plug Tagged: ☐
Set 80 sks cmt from 322 ft. to 0 ft. Plug Type: ANNULUS Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Wells Ranch 13-34 (05-123-20982)/Plugging Procedure (Intent)
Producing Formation: Codell 6770'-6776' Niobrara 6498'-6610'
TD: 6988' PBDT: 6935'
Surface Casing: 8 5/8" 24# @ 406' w/ 225 sxs.
Production Casing: 4 1/2" 10.5 & 11.6# @ 6956' w/ 615 sks cmt (TOC at 322' - CBL)

Tubing: 2 3/8" tubing set at 6754'. (8/20/2008)

Proposed Procedure:

1. MIRU RU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set BP at 6448'. Top with 2 sxs 15.8#/gal cement.
4. TIH with tubing. Set tubing at 650'. RU cementing company. Mix and pump 60 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
5. Fill production casing annulus from 322' to surface using 1 1/4" tubing. (Estimated cement volume 80 sxs.)
6. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Kelsi Welch

Title: Production Tech Date: 3/9/2017 Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved, MIKE

COGCC Approved:

Date: 3/15/2017

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 9/14/2017

COA Type

Description

	1)Prior to starting plugging operations a bradenhead test shall be performed. If the beginning pressure is greater than 25 psi, contact COGCC Engineer for sampling requirements. If pressure remains at the conclusion of the test, or if any liquids were present contact COGCC Engineer for sampling requirements. The Form 17 shall be submitted within 10 days of the test. 2)Submit Form 42 electronically to COGCC 48 hours prior to MIRU. 3)Properly abandon flowlines. Once flowlines are properly abandoned, file electronic form 42. 4)For 650' plug: pump plug and displace. If cement is not circulated to surface, shut-in, WOC 4 hours and tag plug – top of plug must be not deeper than 356' and provide minimum 10 sx plug inside and outside at the surface. Leave at least 100' of cement in the wellbore for each plug.
--	---

Attachment Check List

Att Doc Num

Name

401229059	FORM 6 INTENT SUBMITTED
401229064	WELLBORE DIAGRAM
401229066	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

User Group

Comment

Comment Date

Public Room	Document verification complete 03/09/17	03/09/2017
-------------	---	------------

Total: 1 comment(s)