

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE ET OE ES

Document Number:

401225484

Date Received:

03/06/2017

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.

A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175

Contact Name: Jenifer Hakkarinen

Name of Operator: PDC ENERGY INC

Phone: (303) 8605800

Address: 1775 SHERMAN STREET - STE 3000

Fax:

City: DENVER State: CO Zip: 80203

Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required,

Name: Peterson, Tom

Tel: (303) 815-9641

COGCC contact:

Email: tom.peterson@state.co.us

API Number 05-123-20905-00

Well Name: WYSCAVER

Well Number: 23-5

Location: QtrQtr: NESW Section: 5 Township: 4N Range: 63W Meridian: 6

County: WELD

Federal, Indian or State Lease Number:

Field Name: WATTENBERG

Field Number: 90750

☒ Notice of Intent to Abandon☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.339890

Longitude: -104.464560

GPS Data:

Date of Measurement: 10/27/2010

PDOP Reading: 1.6

GPS Instrument Operator's Name: Steve Cure

Reason for Abandonment:

☐ Dry☒ Production Sub-economic☐ Mechanical Problems☐ OtherCasing to be pulled: ☒ Yes☐ No

Estimated Depth: 1000

Fish in Hole: ☐ Yes☒ No

If yes, explain details below

Wellbore has Uncemented Casing leaks:

☐ Yes☒ No

If yes, explain details below

Details:

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
J SAND	7100	7138			
DAKOTA	7370	7398	08/21/2002	BRIDGE PLUG	7340

Total: 2 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	402	285	402	0	VISU
1ST	7+7/8	4+1/2	10.5	7,577	250	7,577	5,914	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7050 with 2 sacks cmt on top. CIBP #2: Depth 6312 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 475 sks cmt from 1050 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Wyscaver 23-5 (05-123-20905)/Plugging Procedure (Intent)

Producing Formation: J Sand 7100'-7138'

Plugged Back Formation: Dakota 7370'-7398'

Existing CIBP Set at: 7340' (without cement)

TD: 7587' PBTD: 7538'

Surface Casing: 8 5/8" 24# @ 402' w/ 285 sxs.

Production Casing: 4 1/2" 10.5 & 11.6# @ 7577' w/ 250 sks cmt (TOC at 5914' CBL)

Tubing: 2 3/8" tubing set at 7001'. (8/22/2002)

Proposed Procedure:

1. MIRU RU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company. Run gyro survey from 7000' to surface.
3. TIH with dump bailer and 2 sxs 15.8#/gal CI G cement. Spot cement on top of existing CIBP at 7340'.
4. TIH with CIBP. Set BP at 7050'. Top with 2 sxs 15.8#/g cement.
5. TIH with CIBP. Set BP at 6312'. Top with 2 sxs 15.8#/g cement.
6. TIH with casing cutter. Cut 4 1/2" casing at 1000'. Pull cut casing.
7. TIH with tubing to 1050'. RU cementing company. Mix and pump 475 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
8. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen

Title: Reg Tech Date: 3/6/2017 Email: JEnifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: JENKINS, STEVE

Date: 3/15/2017

CONDITIONS OF APPROVAL, IF ANY:

Expiration Date: 9/14/2017

<u>COA Type</u>	<u>Description</u>
	1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) For the 1050' plug: pump plug and displace. If surface casing plug is not circulated to surface then tag plug – must be at 352' or shallower and provide 10 sx plug at the surface. Leave at least 100' of cement in the casing for each plug. 3) Properly abandon flowlines as per Rule 1103. File electronic Form 42 once abandonment complete. 4) Prior to starting plugging operations a Bradenhead test shall be performed. If the beginning pressure is greater than 25 psi, or if pressure remains at the conclusion of the test, or if any liquids were present contact COGCC Engineering for sampling requirements. The Form 17 shall be submitted within 10 days of the test.

Attachment Check List

<u>Att Doc Num</u>	<u>Name</u>
401225484	FORM 6 INTENT SUBMITTED
401225489	WELLBORE DIAGRAM
401225490	WELLBORE DIAGRAM

Total Attach: 3 Files

General Comments

<u>User Group</u>	<u>Comment</u>	<u>Comment Date</u>
Public Room	Document verification complete 03/07/17	03/07/2017

Total: 1 comment(s)