

Document Number:
401241525

Date Received:

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175 Contact Name: Jenifer Hakkarinen
 Name of Operator: PDC ENERGY INC Phone: (303) 8605800
 Address: 1775 SHERMAN STREET - STE 3000 Fax: _____
 City: DENVER State: CO Zip: 80203 Email: Jenifer.Hakkarinen@pdce.com

For "Intent" 24 hour notice required, Name: _____ Tel: _____
 Email: _____

COGCC contact: _____

API Number 05-123-24268-00 Well Number: 42-15
 Well Name: HARVESTER
 Location: QtrQtr: SENE Section: 15 Township: 6N Range: 66W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: BRACEWELL Field Number: 7487

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.490640 Longitude: -104.757110
 GPS Data:
 Date of Measurement: 12/13/2006 PDOP Reading: 1.8 GPS Instrument Operator's Name: H.L. TRACEY
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: _____
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7241	7251	02/23/2017	B PLUG CEMENT TOP	7191
Total: 1 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	455	320	455	0	VISU
1ST	7+7/8	4+1/2	10.5	7,382	833	7,382	480	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7191 with 2 sacks cmt on top. CIBP #2: Depth 6882 with 2 sacks cmt on top.
 CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
 CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 450 ft. with 137 sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
 Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged:

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: 02/23/2017
 *Wireline Contractor: Ranger *Cementing Contractor: Ranger
 Type of Cement and Additives Used: 15.8 PPG CL G Cement
 Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Harvester 42-15 (05-123-24268)/Plugging Procedure
 Producing Formation: Codell 7241'-7251'
 TD: 7412' PBD: 7371'
 Surface Casing: 8 5/8" 24# @ 455' w/ 320 sxs
 Production Casing: 4 1/2" 10.5# @ 7382' w/ 833 sks cmt (TOC 480' - CBL)

Tubing: 2 3/8" tubing set at 7226'. (9/30/2014)

Procedure:

1. MIRU RU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.
3. TIH with CIBP. Set CIBP at 7191'. Top with 2 sxs 15.8#/gal CI G cement.
4. TIH with CIBP. Set CIBP at 6882'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with perforating gun. Perforate 4 1/2" casing at 450'.
7. Pump 137 sxs of 15.8#/gal CI G cement down 4 1/2" casing. Cement circulate to surface.
9. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Jenifer Hakkarinen
 Title: Reg Tech Date: _____ Email: JEnifer.Hakkarinen@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

COA Type	Description

Attachment Check List

Att Doc Num	Name
401241548	WELLBORE DIAGRAM
401241551	CEMENT BOND LOG
401241555	CEMENT JOB SUMMARY

Total Attach: 3 Files

General Comments

User Group	Comment	Comment Date
		Stamp Upon Approval

Total: 0 comment(s)