

Program of Operations

- 1 Excavate around wellbore
- 2 Clean and weld on stub to the 8-5/8" Casing
- 3 Install bowl and BOPs
- 4 Drill out cement and wash down with stiff BHA to 8262'
- 5 Spot plug from 8262'-7900' with class G cement (90 sx) and tag once set
- 6 Spot plug from 7750-7128' with class G cement (160 sx) and tag once set
- 7 Spot plug from 50' below the base of the Fox Hills (75 sx) with class G cement and tag plug once set
- 8 Spot plug from 50' below the base of the Arapahoe (50 sx) with class G cement (no tag).
- 9 Set 20 sx surface plug. Cut off 4' below surface and cap with plate showing well details including: