

# Inspection Photos

8/7/2017

Operator: FOUNDATION ENERGY  
MANAGEMENT LLC - 10112

Location ID: 330865

Inspection Doc. Number: 675103803  
Weld County, CO

Aaron Trujillo  
NE Reclamation Specialist  
COGCC

Inspection Photos  
Operator: FOUNDATION ENERGY MANAGEMENT LLC - 10112  
Location ID: 330865



**Photo 1:** Photo of sign at wellhead.



**Photo 2:** Photo taken from the northwest end of the location, facing west. Photo shows iron tubing that had been stored in the interim area have been removed.

Inspection Photos  
Operator: FOUNDATION ENERGY MANAGEMENT LLC - 10112  
Location ID: 330865



**Photo 3:** Photo taken from the northwest corner of the location, facing east. Photo shows vegetation over the interim area. Previous inspections required operator to perform interim reclamation. Interim areas have not been reclaimed and revegetated per reclamation rule 1003



**Photo 4:** Photo taken from the northwest corner of the location, facing southeast. Photo shows vegetation over the interim area. Previous inspections required operator to perform interim reclamation. Interim areas have not been reclaimed and revegetated per reclamation rule 1003



Inspection Photos  
Operator: FOUNDATION ENERGY MANAGEMENT LLC - 10112  
Location ID: 330865



**Photo 5:** Photo taken from the northwest corner of the location, facing south. Photo shows vegetation over the interim area. Previous inspections required operator to perform interim reclamation. Interim areas have not been reclaimed and revegetated per reclamation rule 1003



**Photo 6:** Photo taken from the west end of the location. Photo shows vegetation throughout the interim area is predominantly undesirable weedy plant species such as kochia, russian thistle and puncturevine.

Inspection Photos  
Operator: FOUNDATION ENERGY MANAGEMENT LLC - 10112  
Location ID: 330865



**Photo 7:** Photo taken from the southwest corner of the location, facing north. Photo shows vegetation over the interim area. Vegetation throughout the interim area is predominantly undesirable weedy plant species such as kochia, russian thistle and puncturevine. Previous inspections required operator to perform interim reclamation. Interim areas have not been reclaimed and revegetated per reclamation rule 1003



**Photo 8:** Photo taken from the southwest corner of the location, facing east. Photo shows vegetation over the interim area. Vegetation throughout the interim area is predominantly undesirable weedy plant species such as kochia, russian thistle and puncturevine. Previous inspections required operator to perform interim reclamation. Interim areas have not been reclaimed and revegetated per reclamation rule 1003



Inspection Photos  
Operator: FOUNDATION ENERGY MANAGEMENT LLC - 10112  
Location ID: 330865



**Photo 7:** Photo taken from the southwest end of the location. Photo shows vegetation throughout the interim area is predominantly undesirable weedy plant species such as kochia, russian thistle and puncturevine.



**Photo 8:** Photo taken from the south end of the location, facing east. Photo shows erosion degradation on the location has not been repaired, and stormwater and sediment control BMPs have not been installed.