

**FORM
INSP**Rev
X/15**State of Colorado
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

08/11/2017

Submitted Date:

08/16/2017

Document Number:

682402618**FIELD INSPECTION FORM**
 Loc ID 439225 Inspector Name: Binschus, Chris On-Site Inspection ☐ 2A Doc Num: _____
Operator Information:OGCC Operator Number: 26580Name of Operator: BURLINGTON RESOURCES OIL & GAS LPAddress: PO BOX 4289City: FARMINGTON State: NM Zip: 87499**Status Summary:**

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

Findings:5 Number of Comments0 Number of Corrective Actions☐ Corrective Action Response Requested**Contact Information:**

Contact Name	Phone	Email	Comment
Dixon, Jennifer		Jennifer.A.Dixon@conocophillips.com	Arapahoe/Adams County inspections

Inspected Facilities:

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
439224	WELL	XX	10/19/2016	LO	005-07231	Tiberius 4-64 8-7 4CH	CI

General Comment:

[This is a construction and stormwater inspection in response to Form 42- Notice of construction- Document #401361687.](#)

Location Construction

Location ID: 439225 CDP: _____

Comment: Topsoil stockpile has been stored and temporarily stabilized along the southern and eastern perimeter of the location. Per Rule 1002, topsoil shall be stabilized and protected from degradation due to wind and water erosion. Per Rule 1002, BMPs to prevent weed establishment and to maintain soil microbial activity shall be implemented.

Corrective Action: _____

Date: _____

Form 2A COAs:

Comment: _____

Corrective Action: _____

Date: _____

Wildlife BMPs:

Comment: _____

Corrective Action: _____

Date: _____

Stormwater:

Erosion BMPs	Present	Other BMPs	Present
WADDLES	Yes		

Comments: Erosion BMPs: A temporary BMP (filtrex wattle) has been installed around the entire perimeter of the location. Appears there is a vegetative buffer between the western and southern disturbance area and the BMP to aid in stormwater controls. Please refer to the attached inspection photos for more details.

Other BMPs: _____

Corrective Action: _____

Date: _____

Comment: Follow-up inspection will occur to ensure Operator has installed stormwater BMPs to meet Rule 1002.f. standards.

Corrective
Action: _____

Date: _____

On Site Inspection (305):Surface Owner Contact Information:

Name: _____

Address: _____

Phone Number: _____

Cell Phone: _____

Operator Rep. Contact Information:

Landman Name: _____

Phone Number: _____

Date Onsite Request Received: _____

Date of Rule 306 Consultation: _____

Request LGD Attendance: _____

LGD Contact Information:

Name: _____ Phone Number: _____ Agreed to Attend: _____

Summary of Landowner Issues:

Summary of Operator Response to Landowner Issues:

Onsite Inspection Memorandum Summarizing Discussions at Inspection as Attachment:

Inspected Facilities									
Facility ID:	439224	Type:	WELL	API Number:	005-07231	Status:	XX	Insp. Status:	CI

Attached Documents

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
682402619	Inspection Photos	http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4228197