

**FORM  
INSP**Rev  
X/15**State of Colorado  
Oil and Gas Conservation Commission**1120 Lincoln Street, Suite 801, Denver, Colorado 80203  
Phone: (303) 894-2100 Fax: (303) 894-2109

Inspection Date:

09/08/2017

Submitted Date:

09/12/2017

Document Number:

682402743**FIELD INSPECTION FORM**Loc ID 447898 Inspector Name: Binschus, Chris On-Site Inspection ☐ 2A Doc Num: \_\_\_\_\_**Status Summary:**

- ☐ THIS IS A FOLLOW UP INSPECTION
- ☒ FOLLOW UP INSPECTION REQUIRED
- ☐ NO FOLLOW UP INSPECTION REQUIRED

**Operator Information:**OGCC Operator Number: 10520Name of Operator: CRESCENT POINT ENERGY U.S. CORPAddress: 555 17TH STREET SUITE 1800City: DENVER State: CO Zip: 80202**Findings:**4 Number of Comments0 Number of Corrective Actions☐ Corrective Action Response Requested**Contact Information:**

Contact Name	Phone	Email	Comment
DelHierro, Chris	(303) 382-6768	cdelhierro@crescentpointenergy.com	
Teren, Todd	(303) 308-6271	tteren@crescentpointenergy.com	

**Inspected Facilities:**

Facility ID	Type	Status	Status Date	Well Class	API Num	Facility Name	Insp Status
447898	LOCATION	AC	09/29/2016		-	Anderson Facility 9-59-31-SESU	CI

**General Comment:**[This is a construction and stormwater inspection to Field Inspection Report Document #401376504.](#)

**Location Construction**

Location ID: 447898 CDP: \_\_\_\_\_

Comment: Topsoil salvage operations IN-PROCESS. Per Rule 1002, topsoil shall be stabilized and protected from degradation due to wind and water erosion. Per Rule 1002, BMPs to prevent weed establishment and to maintain soil microbial activity shall be implemented.

Corrective Action: \_\_\_\_\_ Date: \_\_\_\_\_

**Form 2A COAs:**

Comment: \_\_\_\_\_

Corrective Action: \_\_\_\_\_ Date: \_\_\_\_\_

**Wildlife BMPs:**

Comment: \_\_\_\_\_

Corrective Action: \_\_\_\_\_ Date: \_\_\_\_\_

**Stormwater:**

Erosion BMPs	Present	Other BMPs	Present
DITCHES	Yes		

Comments: Erosion BMPs: A temporary BMP (ditch) has been installed around the entire perimeter of the location. Please refer to the attached inspection photos for more details.

Other BMPs: \_\_\_\_\_

Corrective Action: \_\_\_\_\_ Date: \_\_\_\_\_

**Comment:** At the time of this inspection, the temporary BMP appears sufficient during topsoil salvage operations and initial pad construction. More permanent BMPs should be installed upon the completion of pad construction. BMPs should remain in place and in proper functioning condition until the location is abandoned and final reclamation is achieved pursuant to Rule 1004. A follow-up inspection will occur to ensure Operator has installed stormwater BMPs to meet Rule 1002.f. standards.

**Corrective Action:** \_\_\_\_\_

Date: \_\_\_\_\_

**On Site Inspection (305):**Surface Owner Contact Information:

Name: \_\_\_\_\_ Address: \_\_\_\_\_

Phone Number: \_\_\_\_\_ Cell Phone: \_\_\_\_\_

Operator Rep. Contact Information:

Landman Name: \_\_\_\_\_ Phone Number: \_\_\_\_\_

Date Onsite Request Received: \_\_\_\_\_ Date of Rule 306 Consultation: \_\_\_\_\_

Request LGD Attendance: \_\_\_\_\_

LGD Contact Information:

Name: \_\_\_\_\_ Phone Number: \_\_\_\_\_ Agreed to Attend: \_\_\_\_\_

Summary of Landowner Issues:

\_\_\_\_\_

Summary of Operator Response to Landowner Issues:

\_\_\_\_\_

Onsite Inspection Memorandum Summarizing Discussions at Inspection as Attachment:

\_\_\_\_\_

**Inspected Facilities**Facility ID: 447898 Type: LOCATION API Number: - Status: AC Insp. Status: CI**Attached Documents**You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
682402744	Inspection Photos	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4249008">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4249008</a>