



**Environmental**

**Spills/Releases:**

Type of Spill: CONDENSATE Estimated Spill Volume: 3

Comment: Spill #452038 included 3bbl condensate plus 35 bbl PW from a corrosion hole in 300bbl AST tank bottom. Tank has been emptied, removed from berm and staged on location. SPCC is dirt floor and berms and apparently spill infiltrated. Spill area ihas not been excavated. Spill area has faint staining and odor.

Corrective Action: Complete assessment and remediation per COA of F-19. If Table 910-1 compliance cannot be attained by excavation and offsite disposal, submit F-27 assessemtn and remediation plan, if onsite treatment i.e.landfarm is proposed, obtain surface owner permission then submit design and operations plan plus schedule. Date: 10/06/2017

Reportable: \_\_\_\_\_ GPS: Lat \_\_\_\_\_ Long \_\_\_\_\_

Proximity to Surface Water: \_\_\_\_\_ Depth to Ground Water: \_\_\_\_\_

**Water Well Complaint:**

DWR Receipt Num: \_\_\_\_\_ Owner Name: \_\_\_\_\_ GPS : \_\_\_\_\_ Lat \_\_\_\_\_ Long \_\_\_\_\_

**Field Parameters:**

Sample Location: \_\_\_\_\_ Comment: \_\_\_\_\_

**Attached Documents**

You can go to COGCC Images (<https://cogcc.state.co.us/weblink/>) and search by document number:

Document Num	Description	URL
401397612	INSPECTION SUBMITTED	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4246105">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4246105</a>
690300048	Inspection photos	<a href="http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4246100">http://ogccweblink.state.co.us/DownloadDocumentPDF.aspx?DocumentId=4246100</a>