

FORM
6Rev
12/05State of Colorado
Oil and Gas Conservation Commission

1120 Lincoln Street, Suite 801, Denver, Colorado 80203 Phone: (303) 894-2100 Fax: (303) 894-2109



DE	ET	OE	ES
Document Number: 401405960			
Date Received:			

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set. A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 69175	Contact Name: Kelsi Welch
Name of Operator: PDC ENERGY INC	Phone: (303) 831-3974
Address: 1775 SHERMAN STREET - STE 3000	Fax:
City: DENVER State: CO Zip: 80203	Email: kelsi.welch@pdce.com
For "Intent" 24 hour notice required, Name: Pesicka, Conor Tel: (970) 415-0789	
COGCC contact: Email: conor.pesicka@state.co.us	

API Number: 05-123-20911-00	Well Number: 43-10
Well Name: WELLS RANCH	
Location: QtrQtr: NESE Section: 10 Township: 5N Range: 63W Meridian: 6	
County: WELD	Federal, Indian or State Lease Number:
Field Name: WATTENBERG	Field Number: 90750

☒ Notice of Intent to Abandon ☐ Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.412170	Longitude: -104.415860
GPS Data:	
Date of Measurement: 11/01/2007	PDOP Reading: 3.1
GPS Instrument Operator's Name: Holly L. Tracy	
Reason for Abandonment: <input type="checkbox"/> Dry <input checked="" type="checkbox"/> Production Sub-economic <input type="checkbox"/> Mechanical Problems	
<input type="checkbox"/> Other	
Casing to be pulled: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	Estimated Depth: 650
Fish in Hole: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Wellbore has Uncemented Casing leaks: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If yes, explain details below
Details:	

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	6611	6617			
NIOBRARA	6443	6449			
J SAND	7070	7080	10/21/2004	BRIDGE PLUG	6930

Total: 3 zone(s)

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	414	280	414	0	
1ST	7+7/8	4+1/2	10.5	7,301	470	7,301	2,868	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 6930 with 2 sacks cmt on top. CIBP #2: Depth 6393 with 2 sacks cmt on top.
CIBP #3: Depth _____ with _____ sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 225 sks cmt from 700 ft. to 0 ft. Plug Type: STUB PLUG Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged: ☐

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set _____ sacks half in. half out surface casing from _____ ft. to _____ ft. Plug Tagged: ☐

Set _____ sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: ☐ Yes ☐ No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. of _____ inch casing Plugging Date: _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 ☐ Yes ☐ No *ATTACH JOB SUMMARY

Technical Detail/Comments:

Wells Ranch 43-10 (05-123-20911)/Plugging Procedure (Intent)
Producing Formation (Perforations): Niobrara: 6443'-6449' Codell: 6611'-6617' J-Sand: 7070'-7080'
TD: 7495' PBD: 7214'
Surface Casing: 8 5/8" 24# @ 414' w/ 280 sxs
Production Casing: 4 1/2" 10.5# @ 7301' w/ 470 sxs cmt (TOC @ 2868' - CBL). Existing CIBP @ 6930'.

Tubing: 2 3/8" tubing set @ 6596' (10/21/2004).

Proposed Procedure:

1. MIRU pulling unit. Pull 2 3/8" tubing.
2. RU wireline company.A
3. Load dump bailer with 2 sxs of 15.8#/gal CI G cement. TIH with dump bailer and spot on top of existing CIBP @ 6930'.
4. TIH with CIBP. Set BP at 6393'. Top with 2 sxs 15.8#/gal CI G cement.
5. TIH with casing cutter. Cut 4 1/2" casing at 650'. Pull cut casing.
6. TIH with tubing to 700'. RU cementing company. Mix and pump 225 sxs 15.8#/gal CI G cement down tubing. Cement should circulate to surface.
7. Cut surface casing 6' below ground level and weld on cap.

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: Kelsi Welch

Title: Production Tech Date: _____ Email: kelsi.welch@pdce.com

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: _____

Date: _____

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: _____

COA Type

Description

--	--

Attachment Check List

Att Doc Num

Name

401405972	WELLBORE DIAGRAM
401405976	WELLBORE DIAGRAM

Total Attach: 2 Files

General Comments

User Group

Comment

Comment Date

		Stamp Upon Approval
--	--	---------------------

Total: 0 comment(s)