

Engineer: David Hasz
Cell Phone Number: 970-371-8820

PLUG and ABANDONMENT PROCEDURE

HEIN, RICHARD L UNIT A-1

Description

1. Provide 48 hour notice to COGCC prior to rig up per request on approved Form 6 (e.g. call field coordinator, submit Form 42, etc.). Notify Automation Removal Group at least 24 hours prior to rig move. Request they catch and remove plunger, isolate production equipment, and remove any automation prior to rig MIRU.
2. MIRU Slickline. Pull production equipment and tag bottom. Record tag depth in Open Wells. Gyro was run on 05/15/13. RDMO Slickline.
3. Prepare location for base beam equipped rig. Install perimeter fence as needed.
4. Verify COAs before RU.
5. Upon RU, check and record bradenhead pressure. If bradenhead valve is not accessible, re-plumb so that valve is above GL. Blow down bradenhead and re-check pressure the next day. Repeat until pressure stays at 0 psi.
6. MIRU WO rig. Spot a min of 45 jts of 2-3/8" 4.7#, J-55, EUE tbg. Kill well as necessary using biocide treated fresh water. ND WH. NU BOP. Unland tbg using unlanding joint and LD. Release packer set at 7398'.
7. TOO H and SB all 2-3/8" tbg. LD packer.
8. PU and TIH with (5-1/2", 17#) Bit and Scraper on 2-3/8" tbg to 7880'. TOO H and SB 7420' of 2-3/8" tbg. LD Bit and Scraper and remaining tbg.
9. MIRU WL. PU and RIH with (5-1/2", 17#) CIBP and set at +/- 7870' (collars at 7848' & 7890'). POOH. RIH and dump 2 sx cement on CIBP. POOH.
10. PU and RIH with (5-1/2", 17#) CIBP and set at +/- 7420' (collars at 7389' & 7432'). POOH. RDMO WL.
11. MIRU Hydrotesters. TIH with 2-3/8" tbg to 7420' while hydrotesting to 3000 psi. RDMO Hydrotesters.
12. Load hole with biocide treated fresh water and circulate all gas out of well. PT CIBP to 1000psi for 15 minutes.
13. MIRU Cementers. Pump Niobrara Balance Plug: Pump 60 sx (16.4 bbl or 92 cf), assuming 15.8 ppg & 1.53 cf/sk. Volume based on 655' inside 5-1/2", 17# production casing with no excess. Cement will be from 7420'-6765'. RD Cementers.
14. Slowly pull out of the cement. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOO H, SB 1485' 2-3/8" tbg. LD remaining tbg.
15. MIRU WL. PU and RIH with (5-1/2", 17#) CIBP and set at +/- 4340' (collars at 4330' & 4372'). POOH. RIH and dump 2 sx cement on CIBP. POOH.
16. RIH and jet cut 5-1/2", 17# casing at 1385'. RDMO WL.
17. Attempt to establish circulation and circulate (100 bbl) with fresh water containing biocide to remove any gas.
18. ND BOP. ND TH. Un-land casing using a casing spear, not a lifting sub. Rig max pull shall be 100,000#. Max pull over string weight shall be 50,000#. If unable to unland, contact Engineering.

19. Install BOP on casing head with 5-1/2", 17# pipe rams.
20. TOOH and LD all 5-1/2", 17# casing. Remove 5-1/2", 17# pipe rams and install 2-3/8" pipe rams.
21. TIH with mule shoe and 2-3/8" tubing to 1485'.
22. Establish circulation with biocide treated fresh water and pump one hole-volume (124 bbl).
23. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump GAS BLOK Stub Plug: 125 sx (25.7 bbl or 144 cf) with 0.25 lb/sk Polyflake, assuming 15.8 ppg & 1.16 cf/sk. Volume is based on 100' in 5-1/2", 17# production casing with no excess, and 200' in 7.88" bit size with 100% excess factor. The plug is designed to cover 1485'-1185'. RDMO Cementers. Notify engineering if circulation is ever lost during job.
24. TOOH to 800', reverse circulate to ensure that no cement is left in the tubing. WOC per cementing company guidelines. Verify that all gas/fluid migration have been eliminated. TIH with 2-3/8" tbg. to 1185'.
25. RU Cementers. Pump 10 bbls (min) of pre-flush, followed by 5 bbls fresh water spacer. Pump GAS BLOK Shoe Plug: 290 sx (60 bbl or 337 cf) with 0.25 lb/sk Polyflake, assuming 15.8 ppg & 1.16 cf/sk. Volume is based on 381' in 7.88" bit size with 100% excess factor, and 204' in the 8-5/8", 24# surface casing with no excess. The plug is designed to cover 1185'-600'. RDMO Cementers. Notify engineering if circulation is ever lost during job.
26. Slowly pull out of the cement and TOOH to 100'. Reverse circulate using biocide treated fresh water to ensure the tubing is clean. TOOH, LD all 2-3/8" tbg.
27. MIRU WL. Tag cement as needed. RIH 8-5/8", 24# CIBP to 80'. RDMO WL and WO rig.
28. Instruct cementing and wireline contractors to e-mail copies of all job logs/job summaries to rscDJVendors@anadarko.com within 24 hours of completion of the job.
29. Supervisor submit paper copies of all invoices, logs, and reports to VWP Engineering Specialist.
30. Excavation crew to notify One Call to clear excavation area around wellhead and for flow lines.
31. Capping crew will set and secure night cap on 8-5/8", 24# casing head, restrain the casing head, pressure test CIBP to 500 psi with hydrotest pump, then remove night cap and casing head restraints.
32. Excavate hole around surface casing enough to allow welder to cut casing a minimum 5' below ground level.
33. Welder cut casing minimum 5' below ground level.
34. Fill casing to surface using 4500 psi compressive strength cement (NO gravel).
35. Spot weld on steel marker plate. Marker should contain Well name, Well number, legal location (1/4 1/4 descriptor) and API number.
36. Obtain GPS location data as per COGCC Rule 215 and send to rscDJVendors@anadarko.com.
37. Properly abandon flow lines per Rule 1103. File electronic Form 42 once abandonment is complete.
38. Back fill hole with fill. Clean location, and level.
39. Submit Form 6 to COGCC ensuring to provide 'As performed' WBD identifying operations completed.